

AD-A106 293

INTERNATIONAL ENGINEERING CO INC SAN FRANCISCO CA

F/G 13/13

NATIONAL DAM SAFETY PROGRAM. LOWER DRESSER NUMBER 4 DAM (NO 311--ETC(U))


JUN 79 K B KING, M P FORREST, D R SANDERS

DACW43-79-C-0037

NL

UNCLASSIFIED

1 of 1
AD A
104-2-13

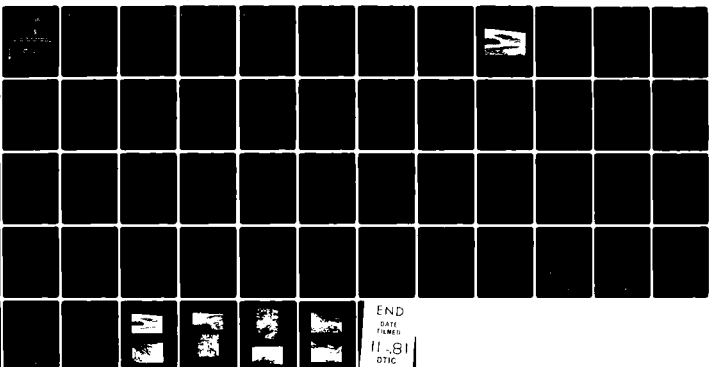

MISSISSIPPI-KASKASKIA-ST. LOUIS BASIN

AD A106293

LEVEL II

①

**LOWER DRESSER NO. 4 DAM
WASHINGTON COUNTY, MISSOURI
MO 31123**

**DTIC
ELECTE
OCT 28 1981
E**

**PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**

FILE COPY



**United States Army
Corps of Engineers**
... Serving the Army
... Serving the Nation

St. Louis District

PREPARED BY: U. S. ARMY ENGINEER DISTRICT, ST. LOUIS

FOR: STATE OF MISSOURI

This document has been approved
for public release and sale; its
distribution is unlimited.

JUNE 1979

8

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
	A106 293	
4. TITLE (and Subtitle) Phase I Dam Inspection Report National Dam Safety Program Lower Dresser No. 4 Dam (MO 31123) Washington County, Missouri		5. TYPE OF REPORT & PERIOD COVERED Final Report
		6. PERFORMING ORG. REPORT NUMBER
7. AUTHOR(s) International Engineering Company, Inc.		8. CONTRACT OR GRANT NUMBER(s) DACW43-79-C-0037
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Engineer District, St. Louis Dam Inventory and Inspection Section, LMSED-PD 210 Tucker Blvd., North, St. Louis, Mo. 63101		12. REPORT DATE June 1979
		13. NUMBER OF PAGES Approximately 70
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		15. SECURITY CLASS. (of this report) UNCLASSIFIED
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for release; distribution unlimited Kenneth B. /King Michael P. /Forrest Donald R. /Sanders		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
National Dam Safety Program, Lower Dresser Number 4 Dam (MO 31123), Mississippi - Kaskaskia - St. Louis Basin, Washington County, Missouri. Phase I Inspection Report.		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety, Lake, Dam Inspection, Private Dams		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report was prepared under the National Program of Inspection of Non-Federal Dams. This report assesses the general condition of the dam with respect to safety, based on available data and on visual inspection, to determine if the dam poses hazards to human life or property.		

DD FORM 1 JAN 79 1473

EDITION OF 1 NOV 65 IS OBSOLETE

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

Page 1 of 1

INSTRUCTIONS FOR PREPARATION OF REPORT DOCUMENTATION PAGE

RESPONSIBILITY. The controlling DoD office will be responsible for completion of the Report Documentation Page, DD Form 1473, in all technical reports prepared by or for DoD organizations.

CLASSIFICATION. Since this Report Documentation Page, DD Form 1473, is used in preparing announcements, bibliographies, and data banks, it should be unclassified if possible. If a classification is required, identify the classified items on the page by the appropriate symbol.

COMPLETION GUIDE

General. Make Blocks 1, 4, 5, 6, 7, 11, 13, 15, and 16 agree with the corresponding information on the report cover. Leave Blocks 2 and 3 blank.

Block 1. Report Number. Enter the unique alphanumeric report number shown on the cover.

Block 2. Government Accession No. Leave Blank. This space is for use by the Defense Documentation Center.

Block 3. Recipient's Catalog Number. Leave blank. This space is for the use of the report recipient to assist in future retrieval of the document.

Block 4. Title and Subtitle. Enter the title in all capital letters exactly as it appears on the publication. Titles should be unclassified whenever possible. Write out the English equivalent for Greek letters and mathematical symbols in the title (see "Abstracting Scientific and Technical Reports of Defense-sponsored RDT/E," AD-667 000). If the report has a subtitle, this subtitle should follow the main title, be separated by a comma or semicolon if appropriate, and be initially capitalized. If a publication has a title in a foreign language, translate the title into English and follow the English translation with the title in the original language. Make every effort to simplify the title before publication.

Block 5. Type of Report and Period Covered. Indicate here whether report is interim, final, etc., and, if applicable, inclusive dates of period covered, such as the life of a contract covered in a final contractor report.

Block 6. Performing Organization Report Number. Only numbers other than the official report number shown in Block 1, such as series numbers for in-house reports or a contractor/grantee number assigned by him, will be placed in this space. If no such numbers are used, leave this space blank.

Block 7. Author(s). Include corresponding information from the report cover. Give the name(s) of the author(s) in conventional order (for example, John R. Doe or, if author prefers, J. Robert Doe). In addition, list the affiliation of an author if it differs from that of the performing organization.

Block 8. Contract or Grant Number(s). For a contractor or grantee report, enter the complete contract or grant number(s) under which the work reported was accomplished. Leave blank in in-house reports.

Block 9. Performing Organization Name and Address. For in-house reports enter the name and address, including office symbol, of the performing activity. For contractor or grantee reports enter the name and address of the contractor or grantee who prepared the report and identify the appropriate corporate division, school, laboratory, etc., of the author. List city, state, and ZIP Code.

Block 10. Program Element, Project, Task Area, and Work Unit Numbers. Enter here the number code from the applicable Department of Defense form, such as the DD Form 1498, "Research and Technology Work Unit Summary" or the DD Form 1634, "Research and Development Planning Summary," which identifies the program element, project, task area, and work unit or equivalent under which the work was authorized.

Block 11. Controlling Office Name and Address. Enter the full, official name and address, including office symbol, of the controlling office. (Equates to funding/sponsoring agency. For definition see DoD Directive 5200.20, "Distribution Statements on Technical Documents.")

Block 12. Report Date. Enter here the day, month, and year or month and year as shown on the cover.

Block 13. Number of Pages. Enter the total number of pages.

Block 14. Monitoring Agency Name and Address (if different from Controlling Office). For use when the controlling or funding office does not directly administer a project, contract, or grant, but delegates the administrative responsibility to another organization.

Blocks 15 & 15a. Security Classification of the Report: Declassification/Downgrading Schedule of the Report. Enter in 15 the highest classification of the report. If appropriate, enter in 15a the declassification/downgrading schedule of the report, using the abbreviations for declassification/downgrading schedules listed in paragraph 4-207 of DoD 5200.1-R.

Block 16. Distribution Statement of the Report. Insert here the applicable distribution statement of the report from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 17. Distribution Statement (of the abstract entered in Block 20, if different from the distribution statement of the report). Insert here the applicable distribution statement of the abstract from DoD Directive 5200.20, "Distribution Statements on Technical Documents."

Block 18. Supplementary Notes. Enter information not included elsewhere but useful, such as: Prepared in cooperation with . . . Translation of (or by) . . . Presented at conference of . . . To be published in . . .

Block 19. Key Words. Select terms or short phrases that identify the principal subjects covered in the report, and are sufficiently specific and precise to be used as index entries for cataloging, conforming to standard terminology. The DoD "Thesaurus of Engineering and Scientific Terms" (TEST), AD-672 000, can be helpful.

Block 20. Abstract. The abstract should be a brief (not to exceed 200 words) factual summary of the most significant information contained in the report. If possible, the abstract of a classified report should be unclassified and the abstract to an unclassified report consist of publicly-releasable information. If the report contains a significant bibliography or literature survey, mention it here. For information on preparing abstracts see "Abstracting Scientific and Technical Reports of Defense-Sponsored RDT&E," AD-667 000.



DEPARTMENT OF THE ARMY
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
210 NORTH 12TH STREET
ST. LOUIS, MISSOURI 63101

IN REPLY REFER TO

Accession For	
NTIS GRA&I	
DTIC TAB	
Unannounced	
Justification	
By	
Distribution/	
Availability Codes	
Avail and/or	
Dist	Special
A	

SUBJECT: Lower Dresser No. 4 Phase I Inspection Report

This report presents the results of field inspection and evaluation of the Lower Dresser No. 4 Dam.

It was prepared under the National Program of Inspection of Non-Federal Dams.

This Dam has been classified as unsafe, non-emergency by the St. Louis District as a result of the application of the following criteria:

1. Spillway will not pass 50 percent of the Probable Maximum Flood.
2. Overtopping of the dam and/or significant erosion of the spillway could result in failure of the dam.
3. Dam failure significantly increases the hazard to loss of life downstream.
4. Excessively steep downstream slope.

SUBMITTED BY:

SIGNED

Chief, Engineering Division

25 SEP 1979

Date

APPROVED BY:

SIGNED

Colonel, CE, District Engineer

25 SEP 1979

Date

LOWER DRESSER NO. 4 DAM
WASHINGTON COUNTY, MISSOURI

MISSOURI INVENTORY NO. 31123

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM

PREPARED BY
INTERNATIONAL ENGINEERING COMPANY, INC.
CONSULTING ENGINEERS
SAN FRANCISCO, CALIFORNIA

UNDER DIRECTION OF
ST. LOUIS DISTRICT, CORPS OF ENGINEERS
FOR
GOVERNOR OF MISSOURI

JUNE 1979

PHASE I REPORT
NATIONAL DAM SAFETY PROGRAM

Name of Dam	Lower Dresser No. 4 Dam
State	Missouri
County	Washington
Stream	Tributary to Mill Creek
Date of Inspection	26 March 1979

Lower Dresser No. 4 Dam was inspected by a civil engineer and an engineering geologist from International Engineering Company, Inc. of San Francisco, California. This dam is owned by Dresser Minerals Division of Potosi, Missouri. The purpose of the inspection was to assess the general condition of the dam with respect to safety. The assessment was based on an evaluation of the available data, a visual inspection, and an evaluation of the hydrology and hydraulics of the site to determine if the dam poses hazards to human life or property. The purpose of the dam is to impound water and tailings from a barite separation and beneficiation operation.

Lower Dresser No. 4 Dam was inspected using the "Recommended Guidelines for Safety Inspection of Dams" furnished by the Department of the Army, Office of the Chief of Engineers. Based on these Guidelines, this dam is classified as intermediate size. The U.S. Corps of Engineers has classified it as having a high downstream hazard potential to indicate that failure of this dam could threaten life and property. The damage zone, estimated by the U.S. Corps of Engineers, extends about 2 miles downstream of the dam. Several dwellings, low-water bridges and railroad bridges are within this damage zone.

The results of the inspection and evaluation indicate that the spillway does not meet the criteria given in the Guidelines for a dam with the size and hazard potential of Lower Dresser No. 4 Dam. As an intermediate size dam with a high hazard potential, it is required by the Guidelines to pass the Probable Maximum Flood (PMF) without overtopping the crest. The PMF is the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that is reasonably possible in the region. It was calculated that the spillway could pass a 100-year flood (a flood having a 1 percent chance of being equalled or exceeded in any 1 year) without overtopping the dam. It was also estimated that the spillway could pass 8 percent of the PMF without significant erosion of the spillway or embankment. However, the spillway cannot pass 50 percent of the PMF without overtopping the dam crest and without significant erosion of the spillway and embankment.

The spillway should be enlarged and/or the freeboard increased so that the PMF can be passed without overtopping the dam and without significant erosion of the embankment and spillway channel. Also, adequate erosion protection should be provided in the spillway.


The size of the downstream channel of the spillway should be enlarged and the channel extended a sufficient distance downstream of the dam to prevent flood discharges from eroding the embankment and/or the soils immediately downstream of the toe of the embankment. Adequate slope protection should be provided to prevent wave action from eroding the upstream face of the dam.

Seepage and stability analyses of the dam are not available. These studies should be performed by a professional engineer experienced in the design and construction of tailings dams and should be made a matter of record.

The trees should be removed from the dam to prevent a potential seepage problem. They should be cleared under the guidance of an engineer experienced in the design and construction of earth dams.

An inspection and maintenance program should be initiated. Periodic inspections should be made and documented by qualified personnel to observe the performance of the dam and spillway.

It is recommended that the owner take action to correct the deficiencies described.


Kenneth B. King, P.E.


Michael P. Forrest, P.E.


Donald R. Sanders, R.G.



OVERVIEW OF LOWER DRESSER NO. 4 DAM
FROM RIGHT ABUTMENT

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
LOWER DRESSER NO. 4 DAM
ID NO. 31123

TABLE OF CONTENTS

<u>Paragraph No.</u>	<u>Title</u>	<u>Page No.</u>
	SECTION 1 - PROJECT INFORMATION	
1.1	General	1
1.2	Description of Project	1
1.3	Pertinent Data	2
	SECTION 2 - ENGINEERING DATA	
2.1	Design	5
2.2	Construction	5
2.3	Operation	5
2.4	Evaluation	5
	SECTION 3 - VISUAL INSPECTION	
3.1	Findings	6
3.2	Evaluation	8
	SECTION 4 - OPERATIONAL PROCEDURES	
4.1	Procedures	9
4.2	Maintenance of Dam	9
4.3	Maintenance of Operating Facilities	9
4.4	Description of Warning System in Effect	9
4.5	Evaluation	9
	SECTION 5 - HYDRAULIC AND HYDROLOGIC ANALYSES	
5.1	Evaluation of Features	10
	SECTION 6 - STRUCTURAL STABILITY	
6.1	Evaluation of Structural Stability	16
	SECTION 7 - ASSESSMENT/REMEDIAL MEASURES	
7.1	Dam Assessment	17
7.2	Remedial Measures	18

APPENDIX A
HYDROLOGIC AND HYDRAULIC ANALYSES

LIST OF PLATES

Plate No.

- | | |
|---|--|
| 1 | Location Map |
| 2 | Vicinity Topography |
| 3 | Plan |
| 4 | Dam Profile |
| 5 | Dam Cross-Section and Spillway Profile |
| 6 | Photograph Location Map |

PHOTOGRAPHS

Photograph Record and Photographs (No. 1 through No. 8)

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
LOWER DRESSER NO. 4 DAM - ID NO. 31123

SECTION 1 - PROJECT INFORMATION

1.1 GENERAL

a. Authority. The National Dam Inspection Act, Public Law 92-367, authorized the Secretary of the Army, through the Corps of Engineers, to initiate a program of safety inspection of dams throughout the United States. Pursuant to the above, the St. Louis District, Corps of Engineers, District Engineer directed that a safety inspection of the Lower Dresser No. 4 Dam be made and authorized International Engineering Company, Inc. to make the inspection.

b. Purpose of Inspection. The purpose of the inspection was to assess the general condition of the dam with respect to safety, based on available data and visual inspection, to determine if the dam poses hazards to human life or property.

c. Evaluation Criteria. Criteria used to evaluate the dam were furnished by the Department of the Army, Office of the Chief of Engineers, in "Recommended Guidelines for Safety Inspection of Dams". These Guidelines were developed with the help of several Federal agencies and many state agencies, professional engineering organizations, and private engineers.

1.2 DESCRIPTION OF PROJECT

a. Description of Dam and Appurtenances.

- (1) Lower Dresser No. 4 Dam is an earthfill dam that is used to impound water and tailings from a barite separation and beneficiation operation. The tailings consist of red-brown soft, silty clay and were deposited as a slurry in a water environment.
- (2) The spillway is an open channel located at the right abutment. It is a broad V-shape at the dam axis and is in operable condition. No other outlets or regulating structures were found.

b. Location. The dam is located in the eastern portion of Washington County, Missouri, as shown in Plate 1. The dam (shown in Plate 2) is located in Section 14, Township 38 North, Range 3 East.

c. Size Classification. This dam is 40 feet high and is therefore in the intermediate size classification, according to the "Recommended Guidelines for Safety Inspection of Dams".

d. Hazard Classification. The U.S. Corps of Engineers has classified this dam in the high hazard potential category. The estimated damage zone, as provided by the Corps of Engineers, extends about 2 miles downstream of the dam. Several dwellings, low-water bridges and Missouri-Pacific Railroad bridges are within this damage zone.

e. Ownership. This dam is owned by:

Dresser Minerals Division
Dresser Industries, Inc.
P.O. Box 8
Potosi, MO 63664

f. Purpose of Dam. The purposes of the dam are to impound tailings from a barite separation and beneficiation operation and to collect surface runoff.

g. Design and Construction History. According to Mr. A. E. Williams, a representative of Dresser Minerals Division, the first stage of construction was completed in about 1957. A second stage was added in 1975 after failure of Dresser No. 4 Dam (I.D. 30474), which is located immediately upstream of Lower Dresser No. 4 Dam. The additional storage capacity was needed to contain muddy water released by Dresser No. 4 Dam when it failed.

h. Normal Operating Procedures. No operating records are known to exist. Dresser personnel consider the tailings impoundment inactive because tailings are no longer conveyed to the pond; however, the impoundment does retain tailings and collect runoff.

1.3 PERTINENT DATA

Field surveys were made by Booker Associates, Inc. of St. Louis Missouri on 28 March 1979. The survey data are shown in Plates 3, 4, and 5.

Drainage Area. 600 acres (Topographic Quadrangle, 7.5-minute series, Tiff, Missouri, 1937).

b. Discharge at Damsite.

- (1) Outlet pipe. There is no outlet pipe at this dam. Not applicable.
- (2) Spillway discharge for pool at top of dam (El. 737.5) - 680 cfs.

- (3) Maximum experienced outflow at damsite - no available information.

c. Elevation (Feet above M.S.L.).^{1/}

- (1) Top of dam - Varies from El. 737.5 to El. 740.5.
- (2) Spillway crest - El. 733.4.
- (3) Streambed at downstream toe of dam - El. 702 ±.
- (4) Water surface on 28 March 1979 (date of survey) - El. 730.4.

d. Reservoir. Length of impoundment - (from aerial photograph, scale: 1 inch = 1000 feet).

- (1) For pool at spillway crest (El. 733.4) - 1000 feet ±.
- (2) For pool at top of dam (El. 737.5) - 1500 feet ±.

e. Storage.

- (1) Spillway crest (El. 733.4) - 103 acre-feet.
- (2) Top of dam (El. 737.5) - 133 acre-feet.

f. Reservoir Surface Area.

- (1) Spillway crest (El. 733.4) - 7.4 acres.
- (2) Top of dam (El. 737.5) - 8.8 acres.

g. Dam.

- (1) Type - Earthfill.
- (2) Length - 311 feet.
- (3) Height (maximum above streambed) - 40 feet.
- (4) Top width - Varies from about 35 to 70 feet.
- (5) Side slopes -
 - (a) Downstream: 1.5(H) to 1.0 (V).
 - (b) Upstream: 1.5(H) to 1.0(V) above water surface.

^{1/} Elevations are based on a reference datum of 743.00 M.S.L. at the temporary bench mark (see Plate 3). This elevation was estimated from the topographic quadrangle.

(6) Zoning - It is not known if a starter dam was constructed. The shell consists of sands and angular gravels generally finer than 7/8-inch.

(7) Cutoff - During an interview, the Dresser representative stated that a cutoff could have been constructed although this could not be confirmed.

h. Spillway.

- (1) Type - uncontrolled open channel spillway at the right abutment.
- (2) Control section - broad V-shape, 4.3-foot depth and 58-foot top width.
- (3) Crest elevation - El. 733.4 M.S.L.
- (4) Upstream channel - wide swale and cleared of vegetation.
- (5) Downstream channel - 3 to 4 feet deep, 5 to 6 feet wide, U-shaped channel in bedrock.

i. Regulating Outlets. None.

j. Diversion Ditches. Two diversion ditches conduct water to the impoundment formed by this dam. A diversion ditch conducts water from the mill site to the upper end of the impoundment. Another diversion ditch carries water from the north end of Dresser No. 4 Dam (I.D. 30474) around the west side of that dam to the upper end of the Lower Dresser No. 4 impoundment. This diversion ditch is U-shaped and about 8 to 10 feet deep. A cross-section of this ditch is shown in Plate 5A in Appendix B.

SECTION 2 - ENGINEERING DATA

2.1 DESIGN

No design drawings or data are known to exist.

2.2 CONSTRUCTION

Mr. A. E. Williams, the owner's representative, indicated that the dam construction began in about 1957. He stated that a core trench may have been built prior to construction of the dam, but no drawings or records exist to confirm this. He also said that a starter dam may not have been constructed. Gravels were hauled to the site and dumped to build the dam. In 1975, the dam was raised to accommodate an increased volume of runoff from the impoundment of Dresser No. 4 Dam (I.D. No. 30474) that had failed. Gravels were hauled to the dam to raise the structure and broaden its crest. The Dresser Minerals representative did not estimate how much the dam was raised during the second stage construction.

2.3 OPERATION

No records of operation are known to exist. The outflow of surface runoff would pass through an uncontrolled spillway.

2.4 EVALUATION

a. Availability. No design or construction records were available. The only information made available to the inspection team was provided during conversations with the owner's representative.

b. Adequacy. The field surveys and visual inspections presented herein are considered adequate to support the conclusions of this report. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available; the lack of this information is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions, including earthquake loads, and should be made a matter of record.

c. Validity. Not applicable because no design data were available.

SECTION 3 - VISUAL INSPECTION

3.1 FINDINGS

a. General. Mr. A. E. Williams of Dresser Minerals met with the inspection team on 21 March 1979 and again, briefly, on 26 March 1979. The dam was inspected by a civil engineer and engineering geologist from International Engineering Company, Inc. on 26 March 1979. The impoundment contains barite mining tailings, and, although tailings are no longer conveyed to the site, the pond is a storage site for runoff. Water was standing in the pond at the time of the inspection, and the tailings were below the water surface. The Dresser representative indicated that the tailings slope down toward the west. The depth of water above the tailings could not be determined. Photographs taken during the inspection are included in this report. The field locations of the photographs are shown in Plate 6.

b. Project Geology. Bedrock in the reservoir area consists of dolomite with chert and druse of the Potosi Formation of Upper Cambrian Age. Outcrops are generally restricted to stream channels. Throughout most of the area, the bedrock is overlain by a red clay that contains remnants of chert, barite, and quartz druse. The red clay can be as much as 15 feet thick, but it averages less than 10 feet in thickness and is thinner on the hillsides. Bedrock is exposed in the spillway channel at the right abutment.

c. Dam. The plan of the dam is shown in Plate 3. The profile and cross-sections of the dam and spillway are shown in Plates 4 and 5.

Vegetation on the embankment is limited. A few scattered trees are growing on the downstream face of the dam, and there are small trees on the crest near the right abutment. The crest and slopes are mostly barren; but grass and briars are growing at the right abutment, and growth tends to be heavier at the ends of the dam.

No sliding, detrimental settlement, depressions, cracking, sinkholes or animal burrows were observed at the embankment. Wave erosion was observed at the water surface line on the upstream face; a 9-inch high scarp and beach were noted.

Two springs were observed at the maximum section of the dam at the downstream toe. The springs are approximately 15 feet apart and are shown on the plan of the dam, Plate 3. At the time of the inspection, the flow from Spring No. 1 was estimated to be 15 to 25 gpm. Spring No. 2 was flowing at an estimated rate of about 5 gpm. The ground was firm at both springs. The flow from both springs was clear and there was no evidence of piping. Some vegetation and trees are growing in the channels where the springs emerge from the dam.

The difference in elevation between the dam crest and the pond water surface varied from 7 to 10 feet on the date of the survey (28 March 1979). The elevation difference from the spillway crest to the low point on the dam crest is 4.1 feet.

There is no slope protection on the upstream face of the dam.

d. Appurtenant Structures. The spillway is an open channel located at the right abutment. The channel bottom is founded in or near the rock surface and is a wide V-shape at the dam axis and then narrows downstream of the dam. A thin mantle of gravelly clay covers the rock surface in the channel bottom at the dam. Clayey soil was observed overlying the bedrock in the side walls of the spillway. The extent and depth of this soil cover could not be determined during the inspection. Bedrock is exposed in the downstream channel, and its entire length has a rough stairstep profile. Downstream of the dam, the channel is approximately 5 to 6 feet wide, 3 to 4 feet deep and U-shaped. The downstream channel is about 200 feet long and curves slightly toward the toe of the dam. The approach to the spillway is a wide swale. There are no other outlets at the dam.

A diversion ditch upstream and to the west of Dresser No. 4 Dam (I.D. No. 30474) directs surface runoff into the pond. Another diversion ditch directs runoff from the mill site into the pond.

e. Reservoir Area. No evidence of landslides was observed along the shoreline of the pond. Minimal erosion was observed along the shoreline of the pond. The shoreline is covered with trees and a thick ground cover of leaves and low vegetation. Sedimentation from natural sources appears to be minor. The reservoir contains soft silty clay tailings and water.

There is a potential for backwater flooding. The pond water surface could reach the downstream toe of Dresser No. 4 Dam, which is located about 1500 feet upstream of Lower Dresser No. 4 Dam. The spillway crest of Lower Dresser No. 4 Dam is only about 1 to 2 feet lower than the toe of Dresser No. 4 Dam.

f. Downstream Channels. Two small, parallel streams join into one about 800 feet downstream of the dam. These flow in shallow channels that range in width from 1.5 to 4.0 feet. Water was flowing at a depth of 2 to 3 inches during the field inspection. The sources of the water were seepage or natural springs located at the toe of the dam. The channel bottoms are covered with small gravel, and the side slopes are heavily vegetated with hardwood trees and brush. The single channel empties into an unnamed tributary of Mill Creek. This tributary ranges from 10 to 15 feet in width. The banks of the channel range from gentle floodplain terraces to steep dolomite cliffs.

3.2 EVALUATION

Erosion of the spillway wall above the rock level adjacent to the dam could occur during heavy flood discharge, and such erosion would threaten the stability of the dam. Flood discharges emerging from the spillway could cause erosion of the embankment and/or the soils immediately downstream of the toe of the dam and could threaten embankment stability.

Except for wave erosion of the upstream face, no indications of slope instability were observed. However, the slopes are steep and are near the angle of repose and long-term stability of the dam cannot be determined until seepage and stability analyses are performed. The trees growing on the dam could pose a potential seepage problem along the root systems.

The embankment is a relatively porous granular structure above the tailings surface. If the water level were to rise to a sufficient depth above the tailings surface due to flood runoff, there could be significant seepage through the embankment which could adversely affect the stability of the dam.

SECTION 4 - OPERATIONAL PROCEDURES

4.1 PROCEDURES

No regulating procedures are known to exist for this structure. Surface water runoff would pass through an uncontrolled spillway channel on the right abutment.

4.2 MAINTENANCE OF DAM

Information available to the inspection team indicates that the dam is not regularly maintained.

4.3 MAINTENANCE OF OPERATING FACILITIES

There are no operating facilities at this dam. Not applicable.

4.4 DESCRIPTION OF WARNING SYSTEM IN EFFECT

Information available to the inspection team indicates that there is no warning system for this dam.

4.5 EVALUATION

The behavior of the dam should be monitored periodically to observe any indications of instability, such as cracks in the dam, sloughing, sudden settlement, erosion of the dam or spillway, or an increase in the volume or turbidity of water emerging from the springs downstream of the dam. A maintenance program should be initiated for the dam and spillway.

SECTION 5 - HYDRAULIC AND HYDROLOGIC ANALYSES

5.1 EVALUATION OF FEATURES

a. Design Data. The significant dimensions of the dam and spillway are presented in Section 1 - Project Information and are also in the accompanying field survey drawings, Plates 3 through 5. Hydrologic or hydraulic design information is not available.

For this evaluation, the watershed drainage area, stream lengths, and reservoir areas were measured from the 1937 7-1/2-minute USGS Tiff, Missouri Quadrangle, which has a 20-foot contour interval. The soil group for this watershed is classified as Clarksville Gravelly Loam, equivalent to a hydrologic soil group B classification, which has a moderate rate of water transmission.

The total drainage area for Lower Dresser No. 4 Dam (I.D. No. 31123) is about 600 acres (0.938 square miles). The watershed location and drainage boundary are shown on Plate 2. Dresser No. 4 Dam (I.D. No. 30474) is located 1500 feet upstream. The entire watershed can be subdivided into three parts, in downstream order, as follows:

<u>Subarea</u>	<u>Incremental Drainage Area (acres)</u>
1. Upper Watershed	454
2. Dresser No. 4 Dam	74
3. Lower Dresser No. 4 Dam Area	72

Land use and vegetation pattern on the watershed were determined from field observations and aerial photographs of the area. The type of land cover and land use were used to estimate runoff curve numbers (CN) for the antecedent moisture conditions (AMC), which in turn, determine the amount of infiltration, retention losses and net runoff.

The design data, information, and assumptions used in the hydrologic and hydraulic analyses for each subarea are individually discussed below.

Subarea 1 - Upper Watershed

This area is the drainage area upstream of Dresser No. 4 Dam but excluding the area within that tailings dam. Land use and type of land cover within Subarea 1 were estimated as follows:

<u>Type of Cover</u>	<u>Approximate Percent of Area</u>
Woodlands	17
Old Mined Areas	50
Recently Mined Areas	10
Homesteads, Roads	10
Tailings (from barite mining)	13

The estimated runoff curve numbers for Subarea 1 are: AMC II, CN 54 and AMC III, CN 73.

It was assumed for these analyses that all the roads and drainage facilities within the watershed would not substantially change the time of concentration or the quantity of the flood contributions to the downstream subareas. There are only minor two-lane roads within the watershed. The old and recently mined areas within Subarea 1 are barite mining sites which left irregular scars on the topography. These areas were assigned lower runoff curve numbers in the overall weighting of the CN for Subarea 1. The computed parameters, such as lag time, unit hydrograph, probable maximum precipitation, losses and net runoff, for Subarea 1 are in Appendix A, in the computer input data and printouts as "Inflow from Upper Watershed".

Subarea 2 - Dresser No. 4 Dam

The survey information of Dresser No. 4 Dam is presented in a report entitled "Phase I Inspection Report, National Dam Safety Program, Dresser No. 4 Dam, Washington County, Missouri, MO 30474, June 1979.

This subarea is enclosed by the tailings dam. The interior of the circular embankment consists of recently disposed tailings from barite mining. The estimated runoff curve numbers are AMC II, CN 80 and AMC III, CN 97. Input data and computed parameters for Subarea 2 are in Appendix A under "Inflow from Breached Circular Embankment".

The northern part (upstream side) of the embankment was breached in August 1975 and the breach is over 300 feet wide. The tailings surface inside the impoundment slopes downward toward the north through the breach while the natural ground surface slopes downward to the south toward the impoundment and forms a topographic depression. The reservoir capacity consists of the storage available in this depression. The reservoir area-capacity data are in Appendix A. The capacities, as calculated in the computer program by the Conic Method, are the relative capacities above the minimum elevation that was entered as input and are not the total reservoir capacities at the given elevations.

The average elevation of the ground surface immediately north of the impoundment was assumed to be El. 807. Drainage from the impoundment is via a diversion ditch. The invert elevation of the ditch at its entrance was assumed to be El. 807, which is the elevation of the ground surface immediately north of the impoundment.

The channel bottom slope approaches critical slope for the beginning reach of the diversion ditch. Two methods were employed to compute the discharge rating curve for the ditch:

- Critical flows at different critical flow depths were computed using the critical flow formula.
- Manning's equation for uniform flow, using the slope of the beginning reach of the ditch as the average slope ($S = 0.00822$) and a Manning's "n" of 0.035.

At various depths, the discharges and velocities computed by the Manning's equation were slightly less than those computed by the critical flow formula. The results computed by the Manning's equation for uniform flow were adopted as the discharge capacities for the ditch. These are shown in Appendix A as Y4 and Y5 cards in the data input and also appear in the computer printouts with other computed parameters under "Routing from Upper Watershed and Circular Embankment to Ditch".

Subarea 3 - Lower Dresser No. 4 Dam

This subarea is the drainage area between Dresser No. 4 Dam (I.D. No. 30474) and Lower Dresser No. 4 Dam (I.D. No. 31123). Land use and type of land cover within this subarea are as follows:

<u>Type of Cover</u>	<u>Approximate Percent of Area</u>
Woodlands	46
Pasture, Roads	17
Old Mined Areas	27
Reservoir (Water and Tailings)	10

The estimated runoff curve numbers are AMC II, CN 56 and AMC III, CN 75. The reservoir (10 percent of the area) is considered to have no infiltration and retention losses during floods. This was entered into the computer program as 10 percent of the area being impervious.

Two cross-sections of the spillway channel at the spillway entrance were surveyed (see Plates 4 and 5). One section is at the embankment center-line and the other section is 10 feet upstream of the center-line. The spillway entrance is flat, and the spillway sections resemble a combination of U-shaped and V-shaped channel sections. The conventional weir flow formulas or the Manning's equation for uniform flow to compute the discharge capacities are not applicable. Therefore, computations of

the spillway discharge rating curve were based on critical flow formulas for U-shaped and V-shaped channels. The results computed for the two channel shapes were averaged to obtain the discharges and velocities at different flow depths. To obtain the reservoir water surface elevations versus spillway discharge capacities, the differences between the spillway crest elevation and the bottom elevation of the surveyed spillway sections were added to the flow depths in the spillway section. Also, the velocity head corresponding to the discharge and velocity computed at each flow depth was added to the respective flow elevations in the spillway to obtain reservoir water surface elevations. Computations of flows over the dam crest were made by the weir formula, with $C = 3.0$. The reservoir elevation versus discharge relationship is in Appendix A as Y4 and Y5 cards in the input data listing and in the computer printouts under the heading of "Spillway Routing from Three Watersheds through Lower Dam".

b. Experience Data. Rainfall, streamflow and flood data for the entire watershed are not available. There is no available evidence of overtopping of Lower Dresser No. 4 Dam.

c. Visual Observations. Specific information on the visual observations is presented in Section 3 - Visual Inspection.

d. Overtopping Potential. The analyses of the flow regime, flood magnitudes, flood volumes and the overtopping potential at Lower Dresser No. 4 Tailings Dam require the following successive steps:

- Compute floods for Subarea 1 - Upper Watershed.
- Compute floods for Subarea 2 - Dresser No. 4 Dam.
- Combine the computed floods for Subareas 1 and 2.
- Route the combined floods through the reservoir and diversion ditch of Dresser No. 4 Dam to obtain the total routed outflows from Subareas 1 and 2.
- Compute floods for Subarea 3 - Lower Dresser No. 4 Dam.
- Combine the routed outflows from Subareas 1 and 2 with the computed floods for Subarea 3 to obtain the total inflow into the project reservoir at Lower Dresser No. 4 Dam.
- Route the total inflow through project reservoir and spillway to determine overtopping potential.

The probable maximum flood (PMF) and floods expressed as a percent of the PMF were individually computed following the steps described above. The probable maximum flood is defined as the hypothetical flood event that

would result from the most severe combination of critical meteorologic and hydrologic conditions that is reasonably possible at a particular location or region.

Separate hydrologic and hydraulic analyses of Dresser No. 4 Dam (upstream) indicates that its diversion ditch cannot pass the 50 percent PMF without significant erosion of the ditch, and possibly causing further failure of the embankment along the downstream toe. Analysis of the manner in which the ditch and embankment would fail requires detailed breaching analyses, which are beyond the scope of work. Therefore, in computing the flood inflows from the upstream subareas into the Lower Dresser No. 4 Reservoir, it was assumed that Dresser No. 4 Dam and the diversion ditch would be intact and would not erode, even though separate analyses pointed to the contrary (for details, see "Phase I Inspection Report, National Dam Safety Program, Dresser No. 4 Dam, Washington County, Missouri, MO 30474, June 1979").

The computed floods were routed through the project reservoir and spillway using the Modified Puls Method of flood routing. For all cases of spillway flood routing, the starting water surface elevation was set at the spillway crest level (El. 733.4).

Results of the routing indicate that the spillway is able to pass the 100-year flood. Routing studies of floods expressed as percentages of the PMF indicate that the spillway can pass about 33 percent of the PMF without overtopping the lowest point of the embankment. However, at 33 percent PMF, the peak spillway routed outflow is about 680 cfs, with a flow depth of 3.2 feet and a flow velocity of about 7.7 feet per second. High velocities and discharges such as those at 33 percent PMF peak outflow could cause significant erosion of the spillway channel and embankment section.

A major consideration in evaluating the safety of the dam is assessing the potential for overtopping and the subsequent failure of the embankment as a result of significant erosion. Since the spillway is composed partly of erodible materials, high velocity discharges through the spillway will lead to erosion of the spillway and the embankment even if the dam is not overtopped. Based on the Corps of Engineers Manual EM 1110-2-1601, "Hydraulic Design of Flood Control Channels", the maximum permissible velocity of the materials found in the spillway and the embankment section was estimated at about 5 feet per second. Using this as the criterion, it was estimated that the spillway can pass about 8 percent of the PMF without significant erosion. The 8 percent PMF peak routed outflow is about 80 cfs, at a flow depth of about 1.3 feet. Thus, for determining the erosion potential of the embankment, flows above 80 cfs and flow depths in the spillway higher than 1.3 feet are considered to produce the effects of significant erosion and subsequent embankment failure.

Results of the overtopping analyses are reported in Appendix A and are summarized below.

<u>Flood</u>	<u>Peak Inflow (cfs)</u>	<u>Peak Outflow (cfs)</u>	<u>Max Res WS Elev (ft)</u>	<u>Spillway Flow Depth (ft)</u>	<u>Spillway Flow Velocity (ft/sec)</u>	<u>Duration Spillway Vel. over 5 ft/sec (hr)</u>
10% PMF	199	134	735.5	1.6*	5.5*	7.2
25% PMF	540	475	737.1	2.8*	7.2*	16.3
50% PMF	1197	1114	738.1**	3.7**	8.2**	17.8
65% PMF	1572	1496	738.6**	4.0**	8.6**	19.0
80% PMF	2010	1947	739.0**	4.3**	9.0**	20.2
PMF	2584	2495	739.6**	4.3**	9.6**	23.0

* These flow depths and velocities are considered to produce the effects of significant erosion.

** Dam overtopped (Minimum Dam Crest, El. 737.5).

Note: Reservoir water surface elevations include the velocity heads corresponding to the velocities computed at the various flow depths for the spillway section.

SECTION 6 - STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

a. Visual Observations. Conditions that may adversely affect the structural stability of this dam are discussed in Section 3.

b. Design and Construction Data. No design or construction data pertaining to the structural stability of the dam were available. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, and the lack of information is considered a deficiency. These seepage and stability analyses should be performed for appropriate loading conditions, including earthquake loads, and should be made a matter of record.

c. Operating Records. No appurtenant structures requiring operation exist at this dam, and no records were located.

d. Post-Construction Changes. The inspection team was not informed of any post-construction changes that may have been made after the dam was raised in 1975.

e. Seismic Stability. The dam is located in Seismic Zone 2, as defined in the Uniform Building Code. Some crest settlement and raveling of the gravels could occur during seismic shaking because the gravels are loose and the downstream slope is near the natural angle of repose.

SECTION 7 - ASSESSMENT/REMEDIAL MEASURES

7.1 DAM ASSESSMENT

a. Safety. There are several deficiencies that should be corrected. (1) Erosion protection in the spillway above the rock line, particularly adjacent to the dam, has not been provided. (2) Flood discharges emerging from the spillway could cause erosion of the embankment and/or the soils immediately downstream of the toe of the dam; this could threaten embankment stability. (3) The discharge capacity of the spillway was computed to be inadequate to pass 50 percent of the Probable Maximum Flood (PMF) without overtopping the dam and without significant erosion of the spillway and embankment. The PMF is the flood that may be expected from the most severe combination of critical meteorologic and hydrologic conditions that is reasonably possible in the region. As an intermediate size dam with a high hazard potential, the "Recommended Guidelines for Safety Inspection of Dams" specifies that the spillway design flood for this dam should be the PMF. (4) Slope protection is lacking on the upstream face of the dam. (5) The trees growing on the dam could pose a potential seepage problem along the root systems. (6) Seepage and stability analyses were not available, and they should be made a matter of record.

b. Adequacy of Information. No detailed design or construction data were available. Seepage and stability analyses comparable to the requirements of the "Recommended Guidelines for Safety Inspection of Dams" were not available, and this lack of information is considered a deficiency.

Results of the hydrologic studies could be changed if larger scale topographic maps with smaller contour intervals were used. The only available topographic map is the 7.5-minute, 1:24,000 scale USGS quadrangle with a 20-foot contour interval. All measurements made on this map, such as drainage area, stream lengths, river slopes, and reservoir area-capacity data, are insufficient in details; but the map suffices for the Phase I inspection. The use of the USGS quadrangle for the hydrologic studies results in an approximate evaluation of the spillway flood discharge capacity.

c. Urgency. The Phase I inspection indicated apparent deficiencies in the condition of the dam and spillway. Initiation of measures to increase the spillway capacity and provide the spillway with adequate erosion protection should be given priority.

d. Necessity for Phase II. No Phase II investigation is recommended; however, additional investigative work should be done as necessary so that seepage and stability analyses can be performed. The investigations should be undertaken by a professional engineer experienced in the design and construction of tailings dams.

7.2 REMEDIAL MEASURES

The following remedial measures are recommended:

a. The spillway channel bottom is excavated into or near bedrock. However, the sides of the channel consist of clayey soil which is erosive under heavy flood discharges. Adequate erosion protection should be provided on the spillway side walls, particularly on the wall adjacent to the dam. The area where soil is above the rockline should be determined before the erosion protection is provided. The erosion protection should be adequate to withstand the peak discharge velocity resulting from the PMF. Alternatively, since bedrock appears to be near the surface, the spillway could be excavated entirely into rock.

b. The size of the downstream channel of the spillway should be enlarged and the channel should be extended a sufficient distance downstream of the dam to prevent flood discharges from eroding the embankment and/or the soils immediately downstream of the embankment toe.

c. The existing spillway capacity was calculated to be adequate to pass 8 percent of the PMF without significant erosion of the spillway and embankment and without overtopping the dam. To comply with the guidelines for a dam of this size and hazard potential, the spillway should be enlarged and/or the freeboard should be increased so that the PMF can be passed without overtopping the dam crest and without significant erosion of the spillway or embankment.

d. Seepage and stability analyses should be performed by a professional engineer experienced in the design and construction of tailings dams. The embankment is a relatively porous granular structure above the tailings surface. If the impoundment water level were to rise to a sufficient depth above the tailings surface, there could be significant seepage through the embankment which could adversely affect the stability of the dam. Included in these analyses, therefore, seepage and stability computations should also be performed with the reservoir water surface set at the top of the dam. Based on the results of the stability studies, remedial measures may become necessary. Remedial work should be done under the direction of an engineer experienced in tailings dam design and construction.

e. Adequate slope protection should be provided to prevent wave action from eroding the upstream face of the dam.

f. The channels downstream of the two springs should be kept cleared so that ponding will not occur.

g. The trees should be removed from the dam to prevent a potential seepage problem. The trees should be cleared under the guidance of an engineer experienced in the design and construction of earth dams.

h. An inspection and maintenance program should be initiated. Periodic inspections should be made by qualified personnel to observe the performance of the dam and spillway. Observations should include indications of instability, such as cracks in the embankment, sloughing, erosion, sudden settlement or an increase in the volume or turbidity of the seepage areas. Records should be kept of these inspections and of any corrective maintenance made to the dam and spillway.

APPENDIX A

HYDROLOGIC AND HYDRAULIC ANALYSES

The hydrologic and hydraulic analyses were accomplished by using the computer program "Flood Hydrograph Package, HEC-1, Dam Safety Investigations Version, July 1978". This program was developed by the Hydrologic Engineering Center, U.S. Army Corps of Engineers, Davis, California. The criteria and methodology used are briefly discussed below:

- Probable Maximum Precipitation (PMP) - The 24-hour PMP was obtained from Hydrometeorological Report No. 33. The 6-hour and the 1-hour depth-duration distributions followed Corps of Engineers EM 1110-2-1411 criteria.
- 100-year and/or 10-year storms - The 24-hour storm amounts and distributions were supplied by Corps of Engineers, St. Louis District, Missouri.
- Unit Hydrograph - The Soil Conservation Service (SCS) curve-linear unit hydrograph method was used. Basin lag time was computed by using the SCS Curve Number Method and equation.
- Hydrologic Soil Group, Antecedent Moisture Condition (AMC) and Curve Number (CN) - The predominant hydrologic soil group for the watershed was obtained from an agricultural soil classification map prepared by the University of Missouri Agricultural Experiment Station. For the PMF and floods expressed as a percent of PMF, AMC III conditions were used. For the 100-year and/or 10-year floods, AMC II conditions were assumed. Watershed CN was estimated from field observations and from aerial photos.
- Reservoir Area-Capacity - Areas were measured from U.S.G.S. topographic maps. Reservoir elevations and corresponding surface areas were input in the computer program, which determined the reservoir capacities by the Conic Method.
- Reservoir and Spillway Flood Routing - The Modified Puls Method was used for all flood routing through spillway and dam overtopping analyses.

The following pages present the input data listing, the computer program version and its last modification date, together with pertinent computer printouts of results. Definitions of all input and output variable names are presented in the computer program "Users Manual", September 1978, and are not explained herein.

2

[illegible]

A-2

A-3

 FLOOD HYDROGRAPH FAC (MFC=1)
 DAM SAFETY ACTION JULY 1978
 LAST MODIFICATION 26 FEB 79

RUN DATE: 79/06/29.
 TIME: 19.10.10.

LOWER PRESSURE NO. 4 (11123)
 PHASE 1 DAM SAFETY INVESTIGATION
 RADIUS OF PWF ROUTED THROUGH RASH

NO	NW	NIN	IDAY	INW	ININ	WETPC	IPIT	IPRT	NSTAN
28A	0	5	0	0	0	0	0	2	0
			INW	NW	INW	INW			
			5	0	0	0			

MULTI-PLAN ANALYSES TO BE PERFORMED
 WPLANE= 1 WPLANE 4 LUTID= 1
 OTIUSE .10 .25 .50 .65 .80 1.00

SUR-AREA RUNOFF COMPUTATION

INFLU FROM UPPER WATERSHED

ISTAG	ICOMP	IECON	ITAPE	JPIT	JPRT	INAME	ISTAGE	IAUTO
INFLU	0	0	0	0	1	0	0	0

IMVIG	IMIG	TAPEA	SNAP	INSDA	IPSPC	RATIO	ISHOW	ISAME	LOCAL
1	2	.71	0.00	.71	1.00	0.000	0	1	0

HYDROGRAPH DATA
 SPEE PWS WA
 0.00 25.50 102.00 120.00 130.00 0.00 0.00 0.00 0.00

UNIT HYDROGRAPH DATA
 LUPIT STAMP DLKBP WJHOL FBAIN STUNS OTIOR STIPL CNSTL ALSW RTIMP
 0 0.00 0.00 1.00 0.00 0.00 1.00 -1.00 -71.00 0.00 0.00

CUOVR UP = -73.00 WITHSS = -1.00 EFFECT CM = 73.00

UNIT HYDROGRAPH DATA
 ICE 0.00 LAU = .77

REFLECTION DATA
 STIRGE -10.00 DPFSE -.10 RTIOR= 2.50

UNIT HYDROGRAPH OF END OF PERIOD DYNAMICS, ICE 0.00 WURS, IAGE .77 VOLE 1.00
 10. 51. 101. 167. 252. 338. 402. 430. 486.
 412. 382. 342. 292. 234. 191. 150. 113. 65.

MO.DA	MM.MN	PEUTID	WATN	TACS	LUSS	(MN-OF-PRFNU) LTH	32. A.	27. S.	23. A.	19. A.	14. S.
MO.DA	MM.MN	PEUTID	WATN	TACS	LUSS	(MN-OF-PRFNU) LTH	32. A.	27. S.	23. A.	19. A.	14. S.
1.01	05	1	.01	0.00	.01	1.01	12.05	145	.22	.18	.04
1.01	10	2	.01	0.00	.01	1.01	12.10	146	.22	.18	.04
1.01	15	3	.01	0.00	.01	1.01	12.15	147	.22	.18	.04
1.01	20	4	.01	0.00	.01	1.01	12.20	148	.22	.18	.04
1.01	25	5	.01	0.00	.01	1.01	12.25	149	.22	.18	.04
1.01	30	6	.01	0.00	.01	1.01	12.30	150	.22	.18	.04
1.01	35	7	.01	0.00	.01	1.01	12.35	151	.22	.18	.04
1.01	40	8	.01	0.00	.01	1.01	12.40	152	.22	.18	.04
1.01	45	9	.01	0.00	.01	1.01	12.45	153	.22	.18	.04
1.01	50	10	.01	0.00	.01	1.01	12.50	154	.22	.18	.04
1.01	55	11	.01	0.00	.01	1.01	12.55	155	.22	.18	.04
1.01	00	12	.01	0.00	.01	1.01	13.00	156	.22	.18	.04
1.01	05	13	.01	0.00	.01	1.01	13.05	157	.26	.23	.05
1.01	10	14	.01	0.00	.01	1.01	13.10	158	.26	.23	.05
1.01	15	15	.01	0.00	.01	1.01	13.15	159	.26	.23	.05
1.01	20	16	.01	0.00	.01	1.01	13.20	160	.26	.24	.05
1.01	25	17	.01	0.00	.01	1.01	13.25	161	.26	.24	.05
1.01	30	18	.01	0.00	.01	1.01	13.30	162	.26	.24	.05
1.01	35	19	.01	0.00	.01	1.01	13.35	163	.26	.24	.05
1.01	40	20	.01	0.00	.01	1.01	13.40	164	.26	.24	.05
1.01	45	21	.01	0.00	.01	1.01	13.45	165	.26	.24	.05
1.01	50	22	.01	0.00	.01	1.01	13.50	166	.26	.24	.05
1.01	55	23	.01	0.00	.01	1.01	13.55	167	.26	.24	.05
1.01	00	24	.01	0.00	.01	1.01	14.00	168	.26	.24	.05
1.01	05	25	.01	0.00	.01	1.01	14.05	169	.33	.30	.07
1.01	10	26	.01	0.00	.01	1.01	14.10	170	.33	.30	.07
1.01	15	27	.01	0.00	.01	1.01	14.15	171	.33	.31	.07
1.01	20	28	.01	0.00	.01	1.01	14.20	172	.33	.31	.07
1.01	25	29	.01	0.00	.01	1.01	14.25	173	.33	.31	.07
1.01	30	30	.01	0.00	.01	1.01	14.30	174	.33	.31	.07
1.01	35	31	.01	0.00	.01	1.01	14.35	175	.33	.31	.07
1.01	40	32	.01	0.00	.01	1.01	14.40	176	.33	.31	.07
1.01	45	33	.01	0.00	.01	1.01	14.45	177	.33	.31	.07
1.01	50	34	.01	0.00	.01	1.01	14.50	178	.33	.31	.07
1.01	55	35	.01	0.00	.01	1.01	14.55	179	.33	.31	.07
1.01	00	36	.01	0.00	.01	1.01	15.00	180	.33	.31	.07
1.01	05	37	.01	0.00	.01	1.01	15.05	181	.33	.31	.07
1.01	10	38	.01	0.00	.01	1.01	15.10	182	.33	.31	.07
1.01	15	39	.01	0.00	.01	1.01	15.15	183	.33	.31	.07
1.01	20	40	.01	0.00	.01	1.01	15.20	184	.33	.31	.07
1.01	25	41	.01	0.00	.01	1.01	15.25	185	.33	.31	.07
1.01	30	42	.01	0.00	.01	1.01	15.30	186	.33	.31	.07
1.01	35	43	.01	0.00	.01	1.01	15.35	187	.33	.31	.07
1.01	40	44	.01	0.00	.01	1.01	15.40	188	.33	.31	.07
1.01	45	45	.01	0.00	.01	1.01	15.45	189	.33	.31	.07
1.01	50	46	.01	0.00	.01	1.01	15.50	190	.33	.31	.07
1.01	55	47	.01	0.00	.01	1.01	15.55	191	.33	.31	.07
1.01	00	48	.01	0.00	.01	1.01	16.00	192	.33	.31	.07
1.01	05	49	.01	0.00	.01	1.01	16.05	193	.33	.31	.07
1.01	10	50	.01	0.00	.01	1.01	16.10	194	.33	.31	.07
1.01	15	51	.01	0.00	.01	1.01	16.15	195	.33	.31	.07
1.01	20	52	.01	0.00	.01	1.01	16.20	196	.33	.31	.07
1.01	25	53	.01	0.00	.01	1.01	16.25	197	.33	.31	.07

1.01	6.30	58	.01	.00	.01	0.	1.01	16.50	198	.50	.50	.00	1891.
1.01	6.35	55	.01	.00	.01	0.	1.01	16.55	199	.50	.50	.00	1893.
1.01	6.40	56	.01	.00	.01	0.	1.01	16.60	200	.50	.50	.00	1895.
1.01	6.45	57	.01	.00	.01	0.	1.01	16.65	201	.50	.50	.00	3375.
1.01	6.50	58	.01	.00	.01	0.	1.01	16.70	202	.50	.50	.00	3092.
1.01	6.55	59	.01	.00	.01	0.	1.01	16.75	203	.50	.50	.00	2851.
1.01	6.60	60	.01	.00	.01	0.	1.01	16.80	204	.50	.50	.00	2651.
1.01	6.65	61	.01	.00	.01	1.	1.01	16.85	205	.50	.50	.00	2801.
1.01	6.70	62	.01	.00	.01	1.	1.01	16.90	206	.50	.50	.00	2554.
1.01	6.75	63	.01	.00	.01	1.	1.01	16.95	207	.50	.50	.00	2736.
1.01	6.80	64	.01	.00	.01	1.	1.01	17.00	208	.50	.50	.00	2132.
1.01	6.85	65	.01	.00	.01	2.	1.01	17.05	209	.50	.50	.00	2036.
1.01	6.90	66	.01	.00	.01	2.	1.01	17.10	210	.50	.50	.00	1956.
1.01	6.95	67	.01	.00	.01	3.	1.01	17.15	211	.50	.50	.00	1877.
1.01	7.00	68	.01	.00	.01	3.	1.01	17.20	212	.50	.50	.00	1808.
1.01	7.05	69	.01	.00	.01	4.	1.01	17.25	213	.50	.50	.00	1736.
1.01	7.10	70	.01	.00	.01	4.	1.01	17.30	214	.50	.50	.00	1673.
1.01	7.15	71	.01	.00	.01	5.	1.01	17.35	215	.50	.50	.00	1617.
1.01	7.20	72	.01	.00	.01	5.	1.01	17.40	216	.50	.50	.00	1562.
1.01	7.25	73	.01	.00	.01	6.	1.01	17.45	217	.50	.50	.00	1523.
1.01	7.30	74	.01	.00	.01	6.	1.01	17.50	218	.50	.50	.00	1482.
1.01	7.35	75	.01	.00	.01	7.	1.01	17.55	219	.50	.50	.00	1439.
1.01	7.40	76	.01	.00	.01	8.	1.01	17.60	220	.50	.50	.00	1391.
1.01	7.45	77	.01	.00	.01	10.	1.01	17.65	221	.50	.50	.00	1345.
1.01	7.50	78	.01	.00	.01	15.	1.01	17.70	222	.50	.50	.00	1291.
1.01	7.55	79	.01	.00	.01	17.	1.01	17.75	223	.50	.50	.00	1241.
1.01	7.60	80	.01	.00	.01	22.	1.01	17.80	224	.50	.50	.00	1194.
1.01	7.65	81	.01	.00	.01	27.	1.01	17.85	225	.50	.50	.00	1148.
1.01	7.70	82	.01	.00	.01	34.	1.01	17.90	226	.50	.50	.00	1101.
1.01	7.75	83	.01	.00	.01	41.	1.01	17.95	227	.50	.50	.00	1056.
1.01	7.80	84	.01	.00	.01	48.	1.01	18.00	228	.50	.50	.00	1012.
1.01	7.85	85	.01	.00	.01	56.	1.01	18.05	229	.50	.50	.00	969.
1.01	7.90	86	.01	.00	.01	64.	1.01	18.10	230	.50	.50	.00	928.
1.01	7.95	87	.01	.00	.01	73.	1.01	18.15	231	.50	.50	.00	887.
1.01	8.00	88	.01	.00	.01	82.	1.01	18.20	232	.50	.50	.00	847.
1.01	8.05	89	.01	.00	.01	92.	1.01	18.25	233	.50	.50	.00	807.
1.01	8.10	90	.01	.00	.01	101.	1.01	18.30	234	.50	.50	.00	767.
1.01	8.15	91	.01	.00	.01	110.	1.01	18.35	235	.50	.50	.00	727.
1.01	8.20	92	.01	.00	.01	120.	1.01	18.40	236	.50	.50	.00	687.
1.01	8.25	93	.01	.00	.01	130.	1.01	18.45	237	.50	.50	.00	647.
1.01	8.30	94	.01	.00	.01	140.	1.01	18.50	238	.50	.50	.00	607.
1.01	8.35	95	.01	.00	.01	150.	1.01	18.55	239	.50	.50	.00	567.
1.01	8.40	96	.01	.00	.01	160.	1.01	18.60	240	.50	.50	.00	527.
1.01	8.45	97	.01	.00	.01	170.	1.01	18.65	241	.50	.50	.00	487.
1.01	8.50	98	.01	.00	.01	180.	1.01	18.70	242	.50	.50	.00	447.
1.01	8.55	99	.01	.00	.01	190.	1.01	18.75	243	.50	.50	.00	407.
1.01	8.60	100	.01	.00	.01	200.	1.01	18.80	244	.50	.50	.00	367.
1.01	8.65	101	.01	.00	.01	210.	1.01	18.85	245	.50	.50	.00	327.
1.01	8.70	102	.01	.00	.01	220.	1.01	18.90	246	.50	.50	.00	287.
1.01	8.75	103	.01	.00	.01	230.	1.01	18.95	247	.50	.50	.00	247.
1.01	8.80	104	.01	.00	.01	240.	1.01	19.00	248	.50	.50	.00	207.
1.01	8.85	105	.01	.00	.01	250.	1.01	19.05	249	.50	.50	.00	167.
1.01	8.90	106	.01	.00	.01	260.	1.01	19.10	250	.50	.50	.00	127.
1.01	8.95	107	.01	.00	.01	270.	1.01	19.15	251	.50	.50	.00	87.
1.01	9.00	108	.01	.00	.01	280.	1.01	19.20	252	.50	.50	.00	47.
1.01	9.05	109	.01	.00	.01	290.	1.01	19.25	253	.50	.50	.00	7.
1.01	9.10	110	.01	.00	.01	300.	1.01	19.30	254	.50	.50	.00	3.
1.01	9.15	111	.01	.00	.01	310.	1.01	19.35	255	.50	.50	.00	3.
1.01	9.20	112	.01	.00	.01	320.	1.01	19.40	256	.50	.50	.00	3.
1.01	9.25	113	.01	.00	.01	330.	1.01	19.45	257	.50	.50	.00	3.
1.01	9.30	114	.01	.00	.01	340.	1.01	19.50	258	.50	.50	.00	3.
1.01	9.35	115	.01	.00	.01	350.	1.01	19.55	259	.50	.50	.00	3.

1.01	9.50	114	.06	.04	.02	212.	1.01	21.30	254	.02	.02	.02	116.
1.01	9.55	115	.06	.04	.02	215.	1.01	21.35	259	.02	.02	.02	116.
1.01	9.60	116	.06	.04	.02	218.	1.01	21.40	260	.02	.02	.02	116.
1.01	9.65	117	.06	.04	.02	221.	1.01	21.45	261	.02	.02	.02	115.
1.01	9.70	118	.06	.05	.02	224.	1.01	21.50	262	.02	.02	.02	115.
1.01	9.75	119	.06	.05	.02	226.	1.01	21.55	263	.02	.02	.02	115.
1.01	9.80	120	.06	.05	.02	229.	1.01	22.00	264	.02	.02	.02	115.
1.01	9.85	121	.06	.05	.02	231.	1.01	22.05	265	.02	.02	.02	115.
1.01	9.90	122	.06	.05	.02	234.	1.01	22.10	266	.02	.02	.02	116.
1.01	9.95	123	.06	.05	.02	236.	1.01	22.15	267	.02	.02	.02	116.
1.01	10.00	124	.06	.05	.02	238.	1.01	22.20	268	.02	.02	.02	116.
1.01	10.05	125	.06	.05	.02	240.	1.01	22.25	269	.02	.02	.02	116.
1.01	10.10	126	.06	.05	.02	242.	1.01	22.30	270	.02	.02	.02	116.
1.01	10.15	127	.06	.05	.02	244.	1.01	22.35	271	.02	.02	.02	116.
1.01	10.20	128	.06	.05	.02	246.	1.01	22.40	272	.02	.02	.02	116.
1.01	10.25	129	.06	.05	.02	248.	1.01	22.45	273	.02	.02	.02	116.
1.01	10.30	130	.06	.05	.01	250.	1.01	22.50	274	.02	.02	.02	116.
1.01	10.35	131	.06	.05	.01	252.	1.01	22.55	275	.02	.02	.02	116.
1.01	10.40	132	.06	.05	.01	254.	1.01	23.00	276	.02	.02	.02	116.
1.01	10.45	133	.06	.05	.01	256.	1.01	23.05	277	.02	.02	.02	116.
1.01	10.50	134	.06	.05	.01	257.	1.01	23.10	278	.02	.02	.02	116.
1.01	10.55	135	.06	.05	.01	259.	1.01	23.15	279	.02	.02	.02	116.
1.01	10.60	136	.06	.05	.01	260.	1.01	23.20	280	.02	.02	.02	116.
1.01	10.65	137	.06	.05	.01	262.	1.01	23.25	281	.02	.02	.02	116.
1.01	10.70	138	.06	.05	.01	264.	1.01	23.30	282	.02	.02	.02	116.
1.01	10.75	139	.06	.05	.01	265.	1.01	23.35	283	.02	.02	.02	116.
1.01	10.80	140	.06	.05	.01	266.	1.01	23.40	284	.02	.02	.02	116.
1.01	10.85	141	.06	.05	.01	268.	1.01	23.45	285	.02	.02	.02	116.
1.01	10.90	142	.06	.05	.01	269.	1.01	23.50	286	.02	.02	.02	116.
1.01	10.95	143	.06	.05	.01	271.	1.01	23.55	287	.02	.02	.02	116.
1.01	11.00	144	.06	.05	.01	272.	1.02	0.00	288	.02	.02	.02	116.

SUM 33.15 29.00 4.06 158905.
(442.)(730.)(105.)(4499.60)

PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
4222.	1832.	552.	552.	158905.
120.	52.	16.	16.	4499.
	24.00	24.90	24.90	28.00
	609.57	734.15	734.15	734.15
	908.	1094.	1094.	1094.
	1120.	1349.	1349.	1349.

..... SUB-AREA RUNOFF COMPUTATION
IMFLOW FROM BREACHED CIRCULAR EMBANKMENT
151AQ 1C0MP 1ECON 1TAPE 1JPLT 1JPM1 1NAME 1STAGE 1AUTO

1.01	2.40	32	.01	.01	.00	10.	1.01	14.40	174	.33	.32	.00	300.
1.01	2.45	33	.01	.01	.00	10.	1.01	14.45	177	.33	.32	.00	301.
1.01	2.50	34	.01	.01	.00	10.	1.01	14.50	178	.33	.32	.00	302.
1.01	2.55	35	.01	.01	.00	11.	1.01	14.55	179	.33	.32	.00	303.
1.01	3.00	36	.01	.01	.00	11.	1.01	15.00	180	.33	.32	.00	304.
1.01	3.05	37	.01	.01	.00	11.	1.01	15.05	181	.20	.20	.00	299.
1.01	3.10	38	.01	.01	.00	11.	1.01	15.10	182	.40	.40	.00	281.
1.01	3.15	39	.01	.01	.00	11.	1.01	15.15	183	.40	.40	.00	289.
1.01	3.20	40	.01	.01	.00	11.	1.01	15.20	184	.54	.54	.00	323.
1.01	3.25	41	.01	.01	.00	11.	1.01	15.25	185	.69	.69	.00	392.
1.01	3.30	42	.01	.01	.00	11.	1.01	15.30	186	1.64	1.64	.00	529.
1.01	3.35	43	.01	.01	.00	11.	1.01	15.35	187	2.77	2.77	.00	652.
1.01	3.40	44	.01	.01	.00	11.	1.01	15.40	188	1.00	1.00	.00	1244.
1.01	3.45	45	.01	.01	.00	11.	1.01	15.45	189	.69	.69	.00	1371.
1.01	3.50	46	.01	.01	.00	11.	1.01	15.50	190	.50	.50	.00	1214.
1.01	3.55	47	.01	.01	.00	11.	1.01	15.55	191	.40	.40	.00	952.
1.01	4.00	48	.01	.01	.00	12.	1.01	16.00	192	.40	.40	.00	742.
1.01	4.05	49	.01	.01	.00	12.	1.01	16.05	193	.30	.30	.00	445.
1.01	4.10	50	.01	.01	.00	12.	1.01	16.10	194	.30	.30	.00	472.
1.01	4.15	51	.01	.01	.00	12.	1.01	16.15	195	.30	.30	.00	395.
1.01	4.20	52	.01	.01	.00	12.	1.01	16.20	196	.30	.30	.00	346.
1.01	4.25	53	.01	.01	.00	12.	1.01	16.25	197	.30	.30	.00	319.
1.01	4.30	54	.01	.01	.00	12.	1.01	16.30	198	.30	.30	.00	303.
1.01	4.35	55	.01	.01	.00	12.	1.01	16.35	199	.30	.30	.00	293.
1.01	4.40	56	.01	.01	.00	12.	1.01	16.40	200	.30	.30	.00	287.
1.01	4.45	57	.01	.01	.00	12.	1.01	16.45	201	.30	.30	.00	284.
1.01	4.50	58	.01	.01	.00	12.	1.01	16.50	202	.30	.30	.00	283.
1.01	4.55	59	.01	.01	.00	12.	1.01	16.55	203	.30	.30	.00	282.
1.01	5.00	60	.01	.01	.00	12.	1.01	17.00	204	.30	.30	.00	282.
1.01	5.05	61	.01	.01	.00	12.	1.01	17.05	205	.24	.24	.00	278.
1.01	5.10	62	.01	.01	.00	12.	1.01	17.10	206	.24	.24	.00	265.
1.01	5.15	63	.01	.01	.00	12.	1.01	17.15	207	.24	.24	.00	250.
1.01	5.20	64	.01	.01	.00	12.	1.01	17.20	208	.24	.24	.00	238.
1.01	5.25	65	.01	.01	.00	12.	1.01	17.25	209	.24	.24	.00	231.
1.01	5.30	66	.01	.01	.00	12.	1.01	17.30	210	.24	.24	.00	227.
1.01	5.35	67	.01	.01	.00	12.	1.01	17.35	211	.24	.24	.00	224.
1.01	5.40	68	.01	.01	.00	12.	1.01	17.40	212	.24	.24	.00	223.
1.01	5.45	69	.01	.01	.00	12.	1.01	17.45	213	.24	.24	.00	222.
1.01	5.50	70	.01	.01	.00	12.	1.01	17.50	214	.24	.24	.00	222.
1.01	5.55	71	.01	.01	.00	12.	1.01	17.55	215	.24	.24	.00	222.
1.01	6.00	72	.01	.01	.00	12.	1.01	18.00	216	.24	.24	.00	222.
1.01	6.05	73	.06	.06	.00	15.	1.01	18.05	217	.02	.02	.00	209.
1.01	6.10	74	.06	.06	.00	15.	1.01	18.10	218	.02	.02	.00	167.
1.01	6.15	75	.06	.06	.00	15.	1.01	18.15	219	.02	.02	.00	132.
1.01	6.20	76	.06	.06	.00	15.	1.01	18.20	220	.02	.02	.00	120.
1.01	6.25	77	.06	.06	.00	15.	1.01	18.25	221	.02	.02	.00	110.
1.01	6.30	78	.06	.06	.00	15.	1.01	18.30	222	.02	.02	.00	100.
1.01	6.35	79	.06	.06	.00	15.	1.01	18.35	223	.02	.02	.00	91.
1.01	6.40	80	.06	.06	.00	15.	1.01	18.40	224	.02	.02	.00	83.
1.01	6.45	81	.06	.06	.00	15.	1.01	18.45	225	.02	.02	.00	76.
1.01	6.50	82	.06	.06	.00	15.	1.01	18.50	226	.02	.02	.00	69.
1.01	6.55	83	.06	.06	.00	15.	1.01	18.55	227	.02	.02	.00	63.
1.01	7.00	84	.06	.06	.00	15.	1.01	19.00	228	.02	.02	.00	58.
1.01	7.05	85	.06	.06	.00	15.	1.01	19.05	229	.02	.02	.00	53.
1.01	7.10	86	.06	.06	.00	15.	1.01	19.10	230	.02	.02	.00	48.
1.01	7.15	87	.06	.06	.00	15.	1.01	19.15	231	.02	.02	.00	44.
1.01	7.20	88	.06	.06	.00	15.	1.01	19.20	232	.02	.02	.00	40.
1.01	7.25	89	.06	.06	.00	15.	1.01	19.25	233	.02	.02	.00	37.
1.01	7.30	90	.06	.06	.00	15.	1.01	19.30	234	.02	.02	.00	33.
1.01	7.35	91	.06	.06	.00	15.	1.01	19.35	235	.02	.02	.00	30.

● ● ● ● ● ● ● ● ● ●

COMBINE PINOFF, UPPER WAIFRSHO AND CIRCULAR EMBARKMENT

	PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME JANUARY
CAS	4617	2155	450	650	5377
CMS	131	61	19	19	29.56
INCUR		24.15	29.56	29.56	750.77
ACFT		613.35	750.77	1500	1300
MOUS CU M		1060	1300	1413	1613
		1100	1613		

.....

HYDROGRAPH ROUTING

ROUTING FROM UPPER WATERSHED AND CIRCULAR EMBANKMENT

ISTAD ICOMP IELCON ITRAF JPLT JPRT INAME ISTAGE IAUO
 U LANE 1 0 0 2 0 0 0
 ROUTING DATA
 QLOSS CLOSS AVG IPES ISAME IDPT JPMP LSIR
 0.0 0.000 0.00 1 1 0 0 0
 NSTPS NSTDL LAG AMSKK X TSK STORA ISPRAT
 1 0 0 0.000 0.000 0.000 -807. -1

STACF 807.00 808.70 809.90 812.50 815.00 817.60 819.90 820.70 822.40 822.70
 FLUM 0.00 70.00 189.00 621.00 1359.00 2456.00 3160.00 4131.00 6157.00 6967.00
 SURFACE AREA 30.
 CAPACITY 0.
 ELEVATIONS 807. 810. 815. 820. 825. 830. 834. 840.

CREI SPMID COUM EXPW ELEV LCVL CAREA EXPL
 807.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0

DAM DATA

TUPLL CUOD EXPD DAMWID
 824.5 0.0 0.0 0.

STATION U LANE, PLAN 1, RATIO 6

END-OF-PERIOD HYDROGRAPH ORDINATES

INLET		OUTLET	
0.	1.	0.	1.
0.	0.	0.	0.
1.	1.	1.	1.
2.	2.	2.	2.
3.	3.	3.	3.
4.	4.	4.	4.
5.	5.	5.	5.
6.	6.	6.	6.
7.	7.	7.	7.
8.	8.	8.	8.
9.	9.	9.	9.
10.	10.	10.	10.
11.	11.	11.	11.
12.	12.	12.	12.
13.	13.	13.	13.
14.	14.	14.	14.
15.	15.	15.	15.
16.	16.	16.	16.
17.	17.	17.	17.
18.	18.	18.	18.
19.	19.	19.	19.
20.	20.	20.	20.
21.	21.	21.	21.
22.	22.	22.	22.
23.	23.	23.	23.
24.	24.	24.	24.
25.	25.	25.	25.
26.	26.	26.	26.
27.	27.	27.	27.
28.	28.	28.	28.
29.	29.	29.	29.
30.	30.	30.	30.
31.	31.	31.	31.
32.	32.	32.	32.
33.	33.	33.	33.
34.	34.	34.	34.
35.	35.	35.	35.
36.	36.	36.	36.
37.	37.	37.	37.
38.	38.	38.	38.
39.	39.	39.	39.
40.	40.	40.	40.
41.	41.	41.	41.
42.	42.	42.	42.
43.	43.	43.	43.
44.	44.	44.	44.
45.	45.	45.	45.
46.	46.	46.	46.
47.	47.	47.	47.
48.	48.	48.	48.
49.	49.	49.	49.
50.	50.	50.	50.
51.	51.	51.	51.
52.	52.	52.	52.
53.	53.	53.	53.
54.	54.	54.	54.
55.	55.	55.	55.
56.	56.	56.	56.
57.	57.	57.	57.
58.	58.	58.	58.
59.	59.	59.	59.
60.	60.	60.	60.
61.	61.	61.	61.
62.	62.	62.	62.
63.	63.	63.	63.
64.	64.	64.	64.
65.	65.	65.	65.
66.	66.	66.	66.
67.	67.	67.	67.
68.	68.	68.	68.
69.	69.	69.	69.
70.	70.	70.	70.
71.	71.	71.	71.
72.	72.	72.	72.
73.	73.	73.	73.
74.	74.	74.	74.
75.	75.	75.	75.
76.	76.	76.	76.
77.	77.	77.	77.
78.	78.	78.	78.
79.	79.	79.	79.
80.	80.	80.	80.
81.	81.	81.	81.
82.	82.	82.	82.
83.	83.	83.	83.
84.	84.	84.	84.
85.	85.	85.	85.
86.	86.	86.	86.
87.	87.	87.	87.
88.	88.	88.	88.
89.	89.	89.	89.
90.	90.	90.	90.
91.	91.	91.	91.
92.	92.	92.	92.
93.	93.	93.	93.
94.	94.	94.	94.
95.	95.	95.	95.
96.	96.	96.	96.
97.	97.	97.	97.
98.	98.	98.	98.
99.	99.	99.	99.
100.	100.	100.	100.

PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
2275.	1675.	559.	559.	160971.
64.	47.	16.	16.	4558.
	14.77	25.06	25.06	25.06
	476.76	636.45	636.45	636.45
	430.	1109.	1109.	1109.
	1020.	1367.	1367.	1367.

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FOR MULTIPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN RATIO	RATIOS APPLIED TO FLOWS					
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	RATIO 6
HYDROGRAPH AT INFLOW	(.71	1	422.	1055.	2111.	2744.	3378.	4222.
				(11.96)(29.44)(59.78)(77.71)(95.64)(119.55)(
HYDROGRAPH AT INFLOW	(.12	1	137.	343.	685.	891.	1006.	1371.
				(3.44)(9.70)(19.41)(25.23)(31.05)(38.41)(
2 COMBINED UP-ADI	(.43	1	462.	1154.	2308.	3001.	3699.	4617.
				(13.07)(32.08)(65.37)(84.98)(104.50)(130.74)(
ROUTED TO U LAKE	(.63	1	126.	433.	1015.	1365.	1742.	2275.
				(3.57)(12.26)(24.75)(34.67)(50.46)(64.93)(

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1									
RATIO OF PHF	MAXIMUM RESERVOIR ELEVATION	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX OUTFLOW HOURS	TIME OF FAILURE HOURS		
.10	809.27	0.00	149.	126.	0.00	18.50	0.00		
.25	811.37	0.00	250.	433.	0.00	18.00	0.00		
.50	813.84	0.00	399.	1015.	0.00	17.50	0.00		
.75	815.02	0.00	482.	1365.	0.00	17.50	0.00		
.90	816.00	0.00	559.	1742.	0.00	17.42	0.00		
1.00	817.17	0.00	661.	2275.	0.00	17.33	0.00		

1.01	1.00	12	.01	.00	.01	2.	1.01	13.00	157	.22	.20	.02	164.
1.01	1.05	13	.01	.00	.01	2.	1.01	13.05	157	.24	.24	.02	175.
1.01	1.10	14	.01	.00	.01	2.	1.01	13.10	158	.26	.24	.02	189.
1.01	1.15	15	.01	.00	.01	2.	1.01	13.15	159	.26	.24	.02	198.
1.01	1.20	16	.01	.00	.01	1.	1.01	13.20	160	.26	.24	.02	202.
1.01	1.25	17	.01	.00	.01	1.	1.01	13.25	161	.26	.24	.02	208.
1.01	1.30	18	.01	.00	.01	1.	1.01	13.30	162	.26	.24	.02	214.
1.01	1.35	19	.01	.00	.01	1.	1.01	13.35	163	.26	.24	.02	219.
1.01	1.40	20	.01	.00	.01	1.	1.01	13.40	164	.26	.24	.02	226.
1.01	1.45	21	.01	.00	.01	1.	1.01	13.45	165	.26	.24	.02	234.
1.01	1.50	22	.01	.00	.01	1.	1.01	13.50	166	.26	.25	.01	244.
1.01	1.55	23	.01	.00	.01	1.	1.01	13.55	167	.26	.25	.01	256.
1.01	1.60	24	.01	.00	.01	1.	1.01	14.00	168	.26	.25	.01	269.
1.01	2.05	25	.01	.00	.01	1.	1.01	14.05	169	.33	.31	.02	281.
1.01	2.10	26	.01	.00	.01	1.	1.01	14.10	170	.33	.31	.02	292.
1.01	2.15	27	.01	.00	.01	1.	1.01	14.15	171	.33	.31	.01	305.
1.01	2.20	28	.01	.00	.01	1.	1.01	14.20	172	.33	.31	.01	320.
1.01	2.25	29	.01	.00	.01	1.	1.01	14.25	173	.33	.31	.01	335.
1.01	2.30	30	.01	.00	.01	1.	1.01	14.30	174	.33	.31	.01	350.
1.01	2.35	31	.01	.00	.01	1.	1.01	14.35	175	.33	.31	.01	365.
1.01	2.40	32	.01	.00	.01	1.	1.01	14.40	176	.33	.31	.01	380.
1.01	2.45	33	.01	.00	.01	1.	1.01	14.45	177	.33	.31	.01	395.
1.01	2.50	34	.01	.00	.01	1.	1.01	14.50	178	.33	.31	.01	410.
1.01	2.55	35	.01	.00	.01	1.	1.01	14.55	179	.33	.31	.01	425.
1.01	3.00	36	.01	.00	.01	1.	1.01	15.00	180	.33	.31	.01	440.
1.01	3.05	37	.01	.00	.01	1.	1.01	15.05	181	.40	.34	.01	455.
1.01	3.10	38	.01	.00	.01	1.	1.01	15.10	182	.40	.34	.01	470.
1.01	3.15	39	.01	.00	.01	1.	1.01	15.15	183	.40	.34	.01	485.
1.01	3.20	40	.01	.00	.01	1.	1.01	15.20	184	.49	.34	.02	500.
1.01	3.25	41	.01	.00	.01	1.	1.01	15.25	185	.49	.34	.02	515.
1.01	3.30	42	.01	.00	.01	1.	1.01	15.30	186	1.04	.67	.02	530.
1.01	3.35	43	.01	.00	.01	1.	1.01	15.35	187	1.04	.67	.02	545.
1.01	3.40	44	.01	.00	.01	1.	1.01	15.40	188	2.27	1.04	.05	560.
1.01	3.45	45	.01	.00	.01	1.	1.01	15.45	189	2.27	1.04	.05	575.
1.01	3.50	46	.01	.00	.01	1.	1.01	15.50	190	1.09	.67	.02	590.
1.01	3.55	47	.01	.00	.01	1.	1.01	15.55	191	.49	.34	.01	605.
1.01	3.60	48	.01	.00	.01	1.	1.01	15.60	192	.49	.34	.01	620.
1.01	3.65	49	.01	.00	.01	1.	1.01	15.65	193	.49	.34	.01	635.
1.01	3.70	50	.01	.00	.01	1.	1.01	15.70	194	.49	.34	.01	650.
1.01	3.75	51	.01	.00	.01	1.	1.01	15.75	195	.49	.34	.01	665.
1.01	3.80	52	.01	.00	.01	1.	1.01	15.80	196	.49	.34	.01	680.
1.01	3.85	53	.01	.00	.01	2.	1.01	15.85	197	.49	.34	.01	695.
1.01	3.90	54	.01	.00	.01	2.	1.01	15.90	198	.49	.34	.01	710.
1.01	3.95	55	.01	.00	.01	2.	1.01	15.95	199	.49	.34	.01	725.
1.01	4.00	56	.01	.00	.01	2.	1.01	16.00	200	.49	.34	.01	740.
1.01	4.05	57	.01	.00	.01	2.	1.01	16.05	201	.49	.34	.01	755.
1.01	4.10	58	.01	.00	.01	2.	1.01	16.10	202	.49	.34	.01	770.
1.01	4.15	59	.01	.00	.01	2.	1.01	16.15	203	.49	.34	.01	785.
1.01	4.20	60	.01	.00	.01	2.	1.01	16.20	204	.49	.34	.01	800.
1.01	4.25	61	.01	.00	.01	2.	1.01	16.25	205	.49	.34	.01	815.
1.01	4.30	62	.01	.00	.01	2.	1.01	16.30	206	.49	.34	.01	830.
1.01	4.35	63	.01	.00	.01	2.	1.01	16.35	207	.49	.34	.01	845.
1.01	4.40	64	.01	.00	.01	2.	1.01	16.40	208	.49	.34	.01	860.
1.01	4.45	65	.01	.00	.01	2.	1.01	16.45	209	.49	.34	.01	875.
1.01	4.50	66	.01	.00	.01	2.	1.01	16.50	210	.49	.34	.01	890.
1.01	4.55	67	.01	.00	.01	2.	1.01	16.55	211	.49	.34	.01	905.
1.01	4.60	68	.01	.00	.01	2.	1.01	16.60	212	.49	.34	.01	920.
1.01	4.65	69	.01	.00	.01	2.	1.01	16.65	213	.49	.34	.01	935.
1.01	4.70	70	.01	.00	.01	2.	1.01	16.70	214	.49	.34	.01	950.
1.01	4.75	71	.01	.00	.01	2.	1.01	16.75	215	.49	.34	.01	965.
1.01	4.80	72	.01	.00	.01	2.	1.01	16.80	216	.49	.34	.01	980.
1.01	4.85	73	.01	.00	.01	2.	1.01	16.85	217	.49	.34	.01	995.
1.01	4.90	74	.01	.00	.01	2.	1.01	16.90	218	.49	.34	.01	1010.
1.01	4.95	75	.01	.00	.01	2.	1.01	16.95	219	.49	.34	.01	1025.
1.01	5.00	76	.01	.00	.01	2.	1.01	17.00	220	.49	.34	.01	1040.
1.01	5.05	77	.01	.00	.01	2.	1.01	17.05	221	.49	.34	.01	1055.
1.01	5.10	78	.01	.00	.01	2.	1.01	17.10	222	.49	.34	.01	1070.
1.01	5.15	79	.01	.00	.01	2.	1.01	17.15	223	.49	.34	.01	1085.
1.01	5.20	80	.01	.00	.01	2.	1.01	17.20	224	.49	.34	.01	1100.
1.01	5.25	81	.01	.00	.01	2.	1.01	17.25	225	.49	.34	.01	1115.
1.01	5.30	82	.01	.00	.01	2.	1.01	17.30	226	.49	.34	.01	1130.
1.01	5.35	83	.01	.00	.01	2.	1.01	17.35	227	.49	.34	.01	1145.
1.01	5.40	84	.01	.00	.01	2.	1.01	17.40	228	.49	.34	.01	1160.
1.01	5.45	85	.01	.00	.01	2.	1.01	17.45	229	.49	.34	.01	1175.
1.01	5.50	86	.01	.00	.01	2.	1.01	17.50	230	.49	.34	.01	1190.
1.01	5.55	87	.01	.00	.01	2.	1.01	17.55	231	.49	.34	.01	1205.

1.01	8.00	72	.01	1.01	14.10	214	.24	.24	.00	201.
1.01	8.05	71	.06	1.01	14.05	217	.02	.02	.00	198.
1.01	8.10	70	.04	1.01	14.10	218	.02	.02	.00	140.
1.01	8.15	75	.04	1.01	14.15	219	.02	.02	.00	124.
1.01	8.20	76	.06	1.01	14.20	220	.02	.02	.00	117.
1.01	8.25	77	.04	1.01	14.25	221	.02	.02	.00	104.
1.01	8.30	78	.04	1.01	14.30	222	.02	.02	.00	97.
1.01	8.35	79	.06	1.01	14.35	223	.02	.02	.00	84.
1.01	8.40	80	.06	1.01	14.40	224	.02	.02	.00	74.
1.01	8.45	81	.04	1.01	14.45	225	.02	.02	.00	67.
1.01	8.50	82	.04	1.01	14.50	226	.02	.02	.00	61.
1.01	8.55	83	.06	1.01	14.55	227	.02	.02	.00	56.
1.01	7.00	84	.04	1.01	14.00	228	.02	.02	.00	51.
1.01	7.05	85	.06	1.01	14.05	229	.02	.02	.00	47.
1.01	7.10	86	.06	1.01	14.10	230	.02	.02	.00	43.
1.01	7.15	87	.04	1.01	14.15	231	.02	.02	.00	39.
1.01	7.20	88	.06	1.01	14.20	232	.02	.02	.00	35.
1.01	7.25	89	.06	1.01	14.25	233	.02	.02	.00	32.
1.01	7.30	90	.04	1.01	14.30	234	.02	.02	.00	28.
1.01	7.35	91	.04	1.01	14.35	235	.02	.02	.00	25.
1.01	7.40	92	.06	1.01	14.40	236	.02	.02	.00	22.
1.01	7.45	93	.04	1.01	14.45	237	.02	.02	.00	18.
1.01	7.50	94	.06	1.01	14.50	238	.02	.02	.00	14.
1.01	7.55	95	.04	1.01	14.55	239	.02	.02	.00	12.
1.01	8.00	96	.06	1.01	20.00	240	.02	.02	.00	10.
1.01	8.05	97	.04	1.01	20.05	241	.02	.02	.00	8.
1.01	8.10	98	.04	1.01	20.10	242	.02	.02	.00	6.
1.01	8.15	99	.06	1.01	20.15	243	.02	.02	.00	4.
1.01	8.20	100	.04	1.01	20.20	244	.02	.02	.00	2.
1.01	8.25	101	.06	1.01	20.25	245	.02	.02	.00	0.
1.01	8.30	102	.04	1.01	20.30	246	.02	.02	.00	0.
1.01	8.35	103	.04	1.01	20.35	247	.02	.02	.00	0.
1.01	8.40	104	.04	1.01	20.40	248	.02	.02	.00	0.
1.01	8.45	105	.06	1.01	20.45	249	.02	.02	.00	0.
1.01	8.50	106	.06	1.01	20.50	250	.02	.02	.00	0.
1.01	8.55	107	.05	1.01	20.55	251	.02	.02	.00	0.
1.01	9.00	108	.04	1.01	21.00	252	.02	.02	.00	0.
1.01	9.05	109	.04	1.01	21.05	253	.02	.02	.00	0.
1.01	9.10	110	.04	1.01	21.10	254	.02	.02	.00	0.
1.01	9.15	111	.04	1.01	21.15	255	.02	.02	.00	0.
1.01	9.20	112	.06	1.01	21.20	256	.02	.02	.00	0.
1.01	9.25	113	.04	1.01	21.25	257	.02	.02	.00	0.
1.01	9.30	114	.06	1.01	21.30	258	.02	.02	.00	0.
1.01	9.35	115	.04	1.01	21.35	259	.02	.02	.00	0.
1.01	9.40	116	.04	1.01	21.40	260	.02	.02	.00	0.
1.01	9.45	117	.04	1.01	21.45	261	.02	.02	.00	0.
1.01	9.50	118	.06	1.01	21.50	262	.02	.02	.00	0.
1.01	9.55	119	.04	1.01	21.55	263	.02	.02	.00	0.
1.01	10.00	120	.04	1.01	22.00	264	.02	.02	.00	0.
1.01	10.05	121	.06	1.01	22.05	265	.02	.02	.00	0.
1.01	10.10	122	.06	1.01	22.10	266	.02	.02	.00	0.
1.01	10.15	123	.06	1.01	22.15	267	.02	.02	.00	0.
1.01	10.20	124	.04	1.01	22.20	268	.02	.02	.00	0.
1.01	10.25	125	.04	1.01	22.25	269	.02	.02	.00	0.
1.01	10.30	126	.06	1.01	22.30	270	.02	.02	.00	0.
1.01	10.35	127	.04	1.01	22.35	271	.02	.02	.00	0.
1.01	10.40	128	.06	1.01	22.40	272	.02	.02	.00	0.
1.01	10.45	129	.04	1.01	22.45	273	.02	.02	.00	0.
1.01	10.50	130	.06	1.01	22.50	274	.02	.02	.00	0.
1.01	10.55	131	.04	1.01	22.55	275	.02	.02	.00	0.

COMBINATION OF RUNOFF FROM THESE AREAS WITH THE NASIN

A-18

HYDROGRAPH ROUTING

SPILLWAY ROUTING, THREE WATERSHEDS THROUGH LOWER DAM

STAGE FLOW	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
STAGE	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
FLOW	0.00	0.00	54.00	109.00	535.00	1450.00	1800.00	2020.00	3020.00	0020.00
STAGE	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
FLOW	0.00	0.00	54.00	109.00	535.00	1450.00	1800.00	2020.00	3020.00	0020.00
STAGE	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
FLOW	0.00	0.00	54.00	109.00	535.00	1450.00	1800.00	2020.00	3020.00	0020.00

STAGE	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
FLOW	0.00	0.00	54.00	109.00	535.00	1450.00	1800.00	2020.00	3020.00	0020.00
STAGE	715.00	730.10	751.70	736.00	717.50	710.00	730.90	710.50	740.50	741.00
FLOW	0.00	0.00	54.00	109.00	535.00	1450.00	1800.00	2020.00	3020.00	0020.00

CRUI SPWID CUDM EXPW ELFVL CUDM CAPTA EXPL

0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0 0.0

STATION L LANE, PLAN 1, MATIO 6

FND-OF-PERIOD HYDROGRAPH ORDINATES

TIME	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
TIME	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
TIME	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100
TIME	0	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78	79	80	81	82	83	84	85	86	87	88	89	90	91	92	93	94	95	96	97	98	99	100

51 011711111. 50 42


	PIR	6-0000	24-0000	72-0000	TOTAL
1995	100%	100%	65%	65%	100%
1996	100%	100%	100%	100%	100%
1997	100%	100%	100%	100%	100%
1998	100%	100%	100%	100%	100%
1999	100%	100%	100%	100%	100%
2000	100%	100%	100%	100%	100%
2001	100%	100%	100%	100%	100%
2002	100%	100%	100%	100%	100%
2003	100%	100%	100%	100%	100%
2004	100%	100%	100%	100%	100%
2005	100%	100%	100%	100%	100%
2006	100%	100%	100%	100%	100%
2007	100%	100%	100%	100%	100%
2008	100%	100%	100%	100%	100%
2009	100%	100%	100%	100%	100%
2010	100%	100%	100%	100%	100%
2011	100%	100%	100%	100%	100%
2012	100%	100%	100%	100%	100%
2013	100%	100%	100%	100%	100%
2014	100%	100%	100%	100%	100%
2015	100%	100%	100%	100%	100%
2016	100%	100%	100%	100%	100%
2017	100%	100%	100%	100%	100%
2018	100%	100%	100%	100%	100%
2019	100%	100%	100%	100%	100%
2020	100%	100%	100%	100%	100%
2021	100%	100%	100%	100%	100%
2022	100%	100%	100%	100%	100%
2023	100%	100%	100%	100%	100%
2024	100%	100%	100%	100%	100%
2025	100%	100%	100%	100%	100%
2026	100%	100%	100%	100%	100%
2027	100%	100%	100%	100%	100%
2028	100%	100%	100%	100%	100%
2029	100%	100%	100%	100%	100%
2030	100%	100%	100%	100%	100%
2031	100%	100%	100%	100%	100%
2032	100%	100%	100%	100%	100%
2033	100%	100%	100%	100%	100%
2034	100%	100%	100%	100%	100%
2035	100%	100%	100%	100%	100%
2036	100%	100%	100%	100%	100%
2037	100%	100%	100%	100%	100%
2038	100%	100%	100%	100%	100%
2039	100%	100%	100%	100%	100%
2040	100%	100%	100%	100%	100%
2041	100%	100%	100%	100%	100%
2042	100%	100%	100%	100%	100%
2043	100%	100%	100%	100%	100%
2044	100%	100%	100%	100%	100%
2045	100%	100%	100%	100%	100%
2046	100%	100%	100%	100%	100%
2047	100%	100%	100%	100%	100%
2048	100%	100%	100%	100%	100%
2049	100%	100%	100%	100%	100%
2050	100%	100%	100%	100%	100%
2051	100%	100%	100%	100%	100%
2052	100%	100%	100%	100%	100%
2053	100%	100%	100%	100%	100%
2054	100%	100%	100%	100%	100%
2055	100%	100%	100%	100%	100%
2056	100%	100%	100%	100%	100%
2057	100%	100%	100%	100%	100%
2058	100%	100%	100%	100%	100%
2059	100%	100%	100%	100%	100%
2060	100%	100%	100%	100%	100%
2061	100%	100%	100%	100%	100%
2062	100%	100%	100%	100%	100%
2063	100%	100%	100%	100%	100%
2064	100%	100%	100%	100%	100%
2065	100%	100%	100%	100%	100%
2066	100%	100%	100%	100%	100%
2067	100%	100%	100%	100%	100%
2068	100%	100%	100%	100%	100%
2069	100%	100%	100%	100%	100%
2070	100%	100%	100%	100%	100%
2071	100%	100%	100%	100%	100%
2072	100%	100%	100%	100%	100%
2073	100%	100%	100%	100%	100%
2074	100%	100%	100%	100%	100%
2075	100%	100%	100%	100%	100%
2076	100%	100%	100%	100%	100%
2077	100%	100%	100%	100%	100%
2078	100%	100%	100%	100%	100%
2079	100%	100%	100%	100%	100%
2080	100%	100%	100%	100%	100%
2081	100%	100%	100%	100%	100%
2082	100%	100%	100%	100%	100%
2083	100%	100%	100%	100%	100%
2084	100%	100%	100%	100%	100%
2085	100%	100%	100%	100%	100%
2086	100%	100%	100%	100%	100%
2087	100%	100%	100%	100%	100%
2088	100%	100%	100%	100%	100%
2089	100%	100%	100%	100%	100%
2090	100%	100%	100%	100%	100%
2091	100%	100%	100%	100%	100%
2092	100%	100%	100%	100%	100%
2093	100%	100%	100%	100%	100%
2094	100%	100%	100%	100%	100%
2095	100%	100%	100%	100%	100%
2096	100%	100%	100%	100%	100%
2097	100%	100%	100%	100%	100%
2098	100%	100%	100%	100%	100%
2099	100%	100%	100%	100%	100%
2100	100%	100%	100%	100%	100%


WORKER FLOW AND STANDARD (YEAR OF DESIGN) SUMMARY FOR MULTIPLE PLANT-BAYON (FUNDING COMPUTATIONS)
 1965 IN COMBINE FEET PER SECOND (CLINIC METERS PER SECOND)
 AREA IN SQUARE METERS (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	WATERS APPLIED IN FLOWS					
				RATIO 1	RATIO 2	RATIO 3	RATIO 4	RATIO 5	
				.10	.25	.50	.75	1.00	
WATERGARDEN AT INFLUX		.71 (1.84)	1	822.4 (11.06)	1055. (29.84)	2111. (50.78)	2708. (77.71)	3378. (95.68)	4222. (119.55)
WATERGARDEN AT INFLUX		.12 (.31)	1	137. (3.88)	343. (9.70)	685. (19.01)	891. (25.23)	1095. (31.05)	1371. (38.81)
2 CONTAINER		.83 (2.15)	1	482. (13.07)	1154. (32.64)	2108. (65.57)	3001. (84.58)	3988. (108.50)	4617. (130.70)
QUINCEY LN		.83 (2.15)	1	126. (3.57)	485. (12.26)	1015. (28.75)	1365. (38.67)	1782. (50.46)	2275. (64.75)
WATERGARDEN AT INFLUX		.11 (.28)	1	151. (4.24)	378. (10.63)	755. (21.38)	982. (27.80)	1208. (34.21)	1510. (42.77)
2 CONTAINER		.94 (2.41)	1	104. (5.63)	590. (15.28)	1107. (33.00)	1572. (44.50)	2010. (56.02)	2588. (75.18)
QUINCEY LN		.98 (2.51)	1	134. (3.73)	675. (18.86)	1118. (31.56)	1806. (52.46)	1987. (55.13)	2485. (70.66)

SUMMARY OF DAM SAFETY ANALYSIS

PLOT 1	RATIO OF PWR	ELEVATION STORAGE OUTFLOW	INITIAL VALUE	SPILLWAY CREST	TOP OF DAM	TIME OF FAILURE HOURS
			733.00	733.00	737.50	
			45.	45.	124.	
			0.	0.	674.	
PWR	MAXIMUM PRESSURE IN W.S. (LEV)	MAXIMUM DEPTH OVER DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF FAILURE HOURS
0.10	735.51	0.00	111.	134.	0.00	0.00
0.25	737.07	0.00	125.	475.	0.00	0.00
0.50	738.12	0.62	130.	1114.	4.50	0.00
0.75	738.63	1.15	139.	1996.	5.67	0.00
1.00	739.04	1.96	142.	1907.	7.00	0.00
1.25	739.55	2.05	148.	2405.	8.25	0.00
1.50					14.67	0.00
1.75					14.08	0.00
2.00					17.74	0.00
2.25					17.58	0.00
2.50					17.25	0.00
2.75					17.17	0.00

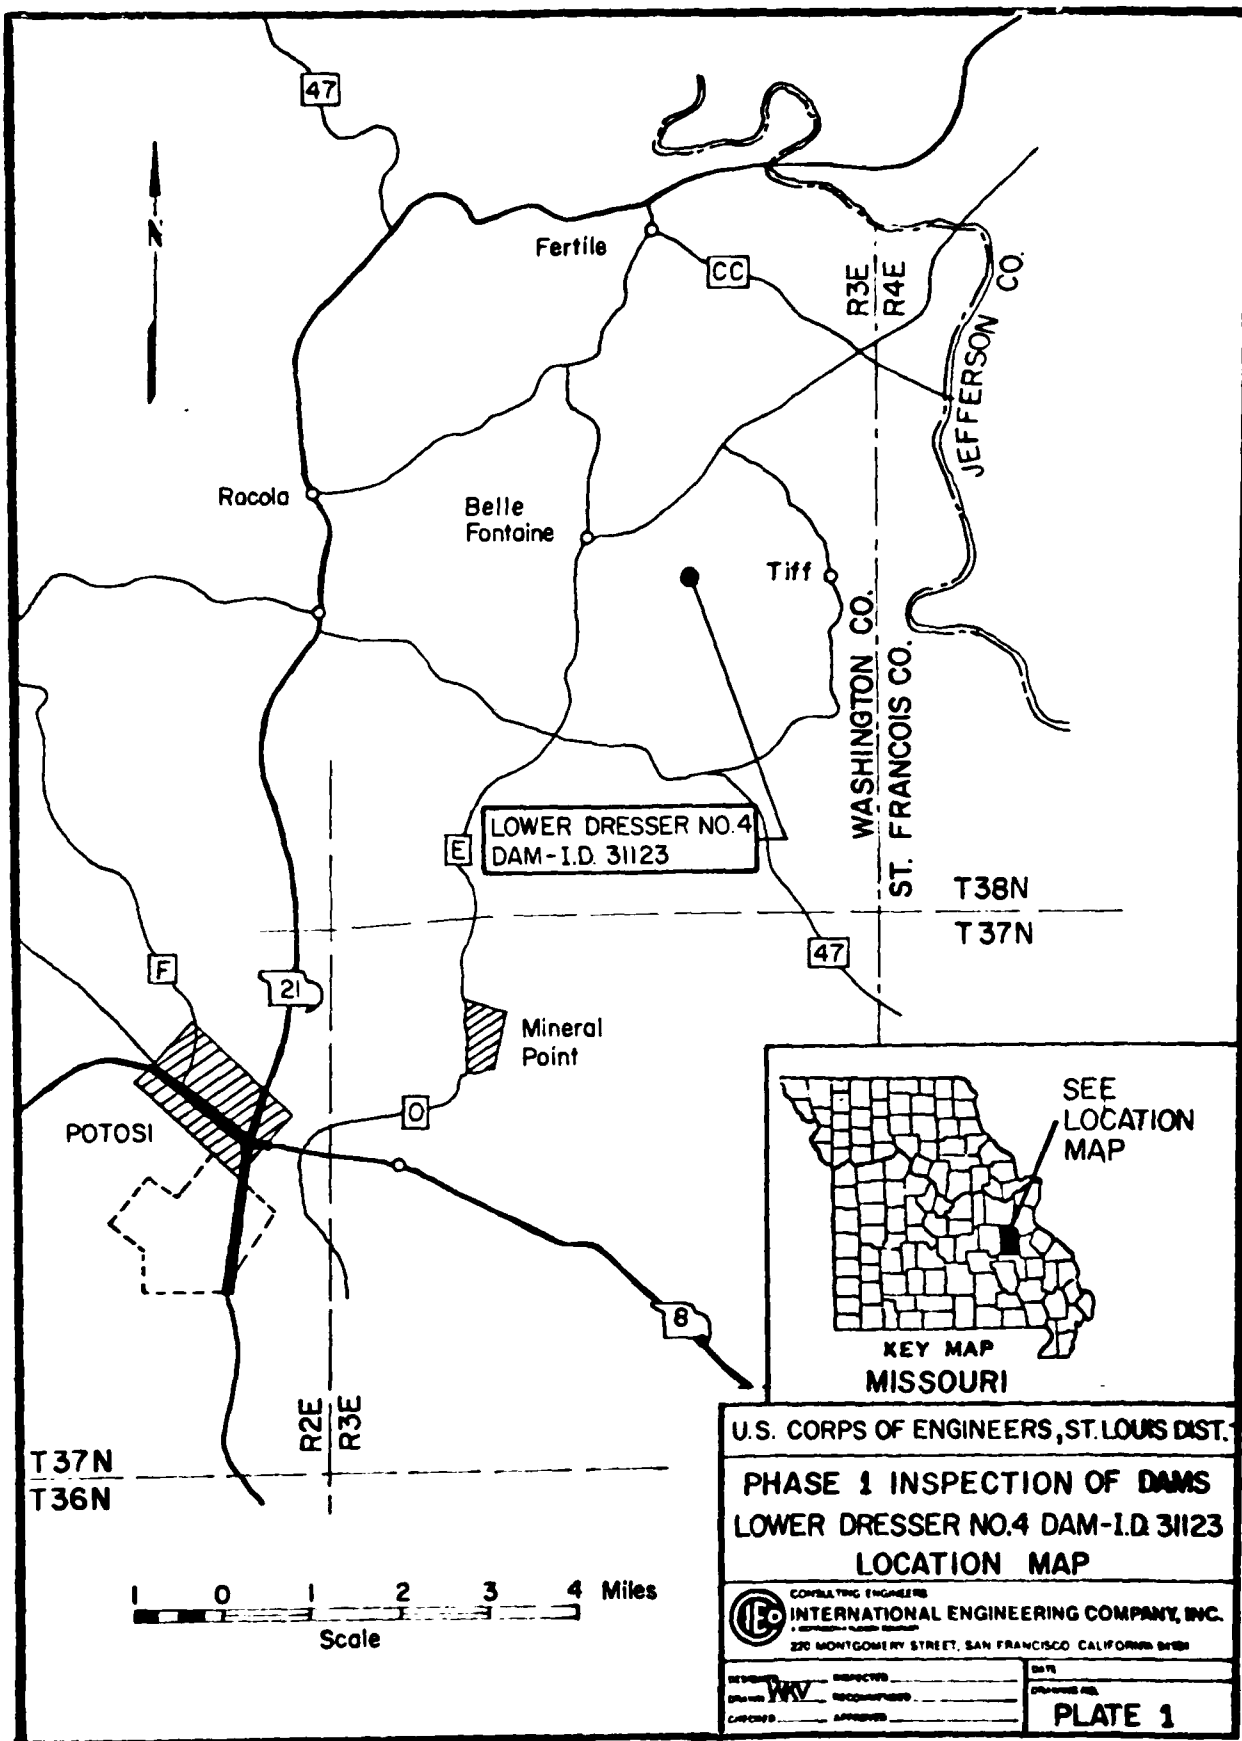

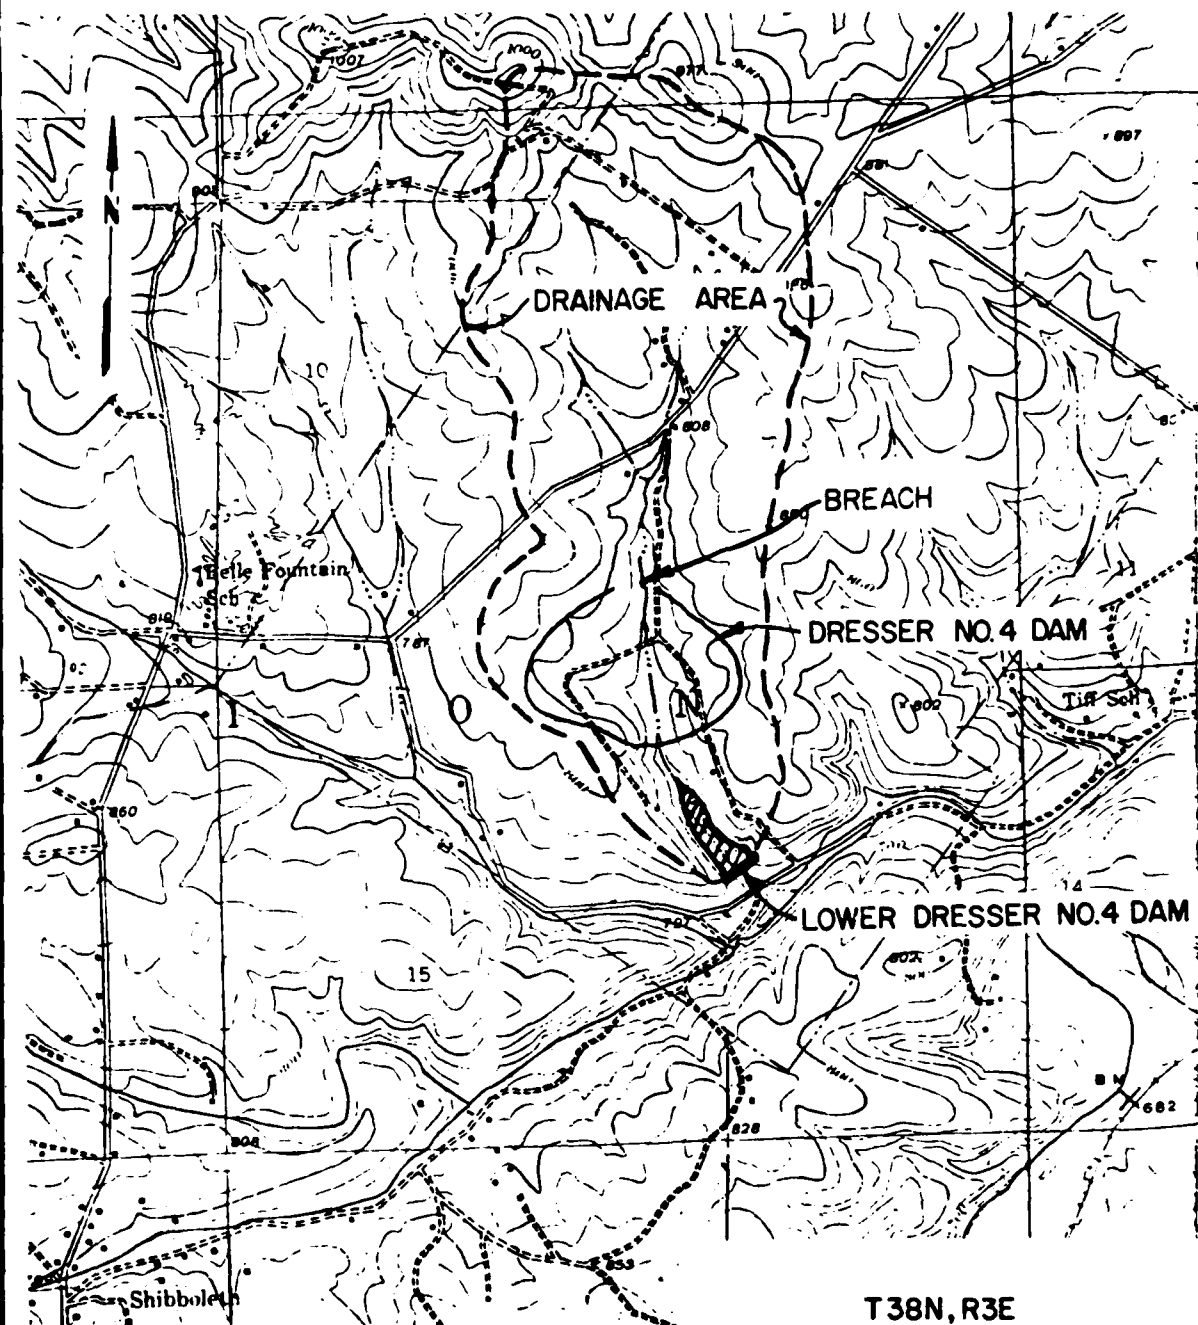

0 2000 4000
SCALE IN FEET

U.S. CORPS OF ENGINEERS, ST. LOUIS DIST.
PHASE I INSPECTION OF DAMS
LOWER DRESSER NO. 4 DAM-I.D.31123
VICINITY TOPOGRAPHY

CONSULTING ENGINEERS
INTERNATIONAL ENGINEERING COMPANY, INC.
220 MONTGOMERY STREET, SAN FRANCISCO, CALIFORNIA 94104

BY ENGINEER _____ INSPECTED BY _____
DRAWN BY _____ RECOMMENDED BY _____
CHECKED BY _____ APPROVED BY _____

DATE _____
DRAWING NO. _____
PLATE 2


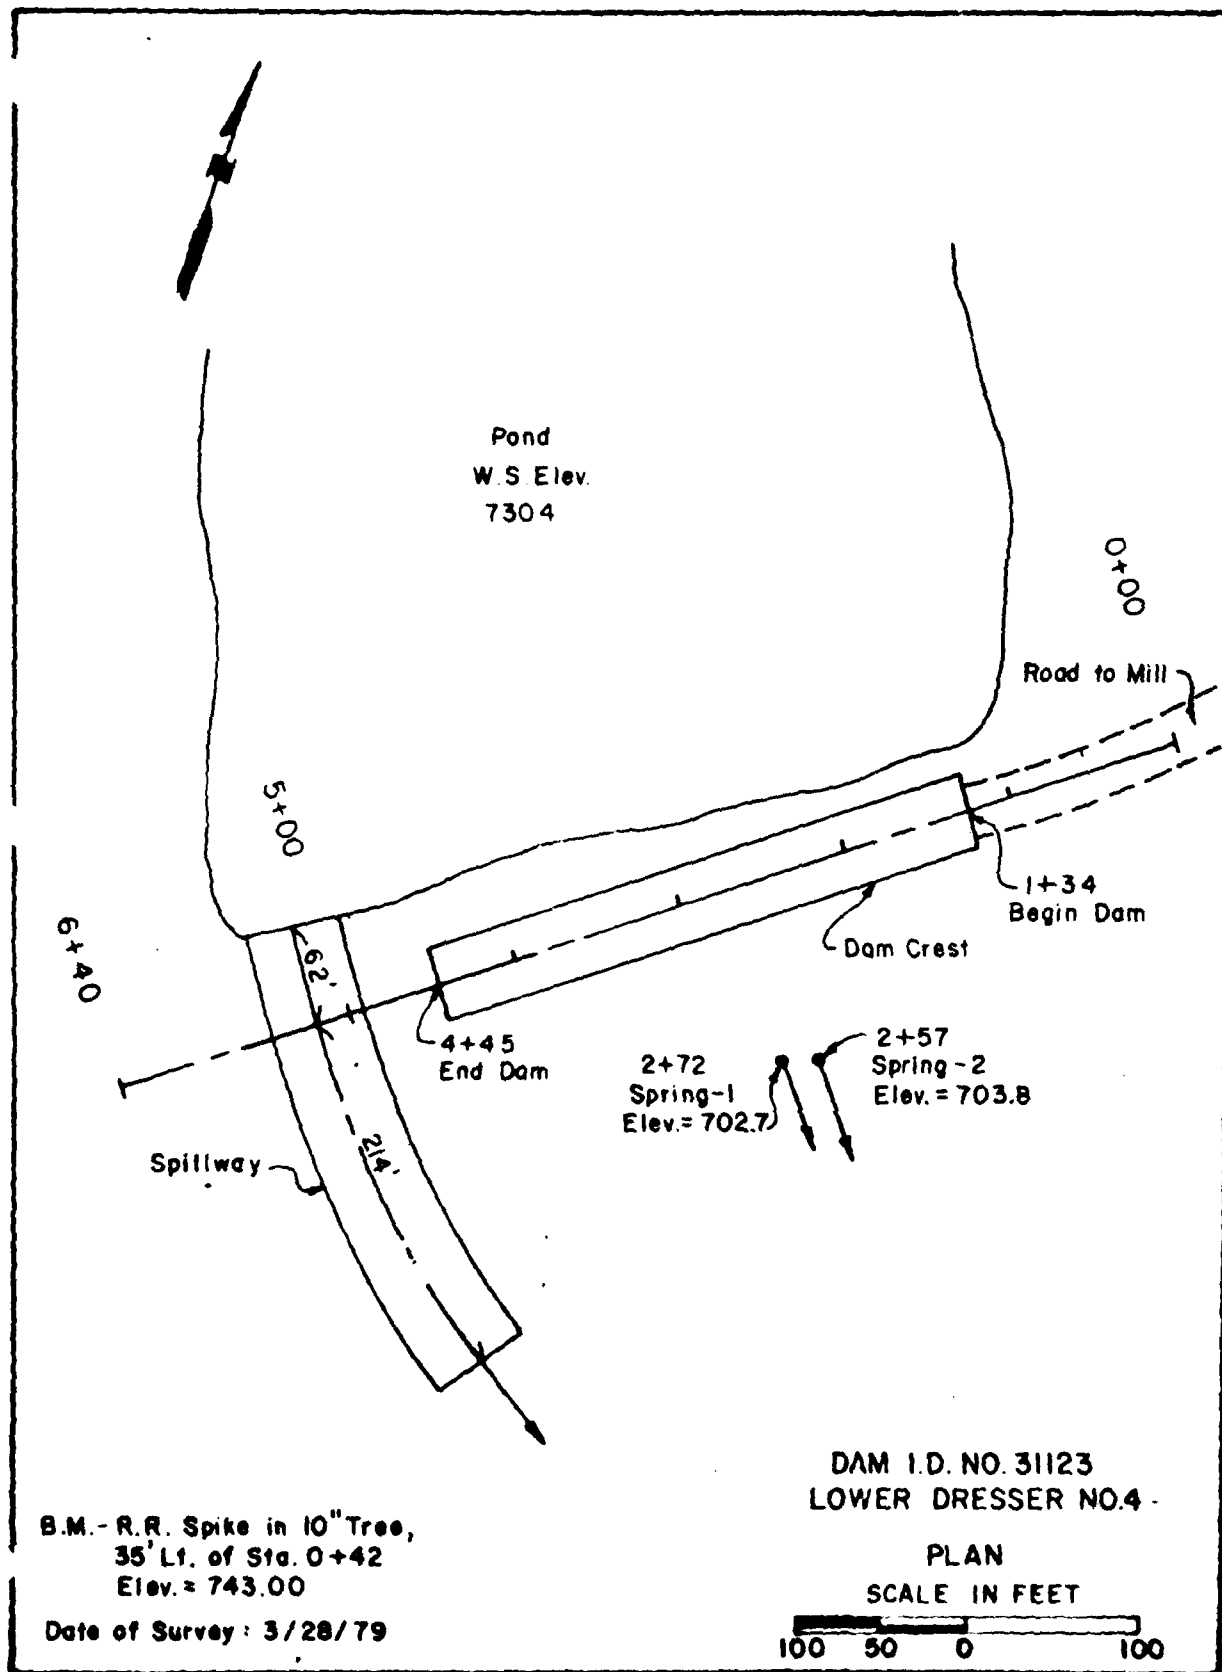


PLATE 3

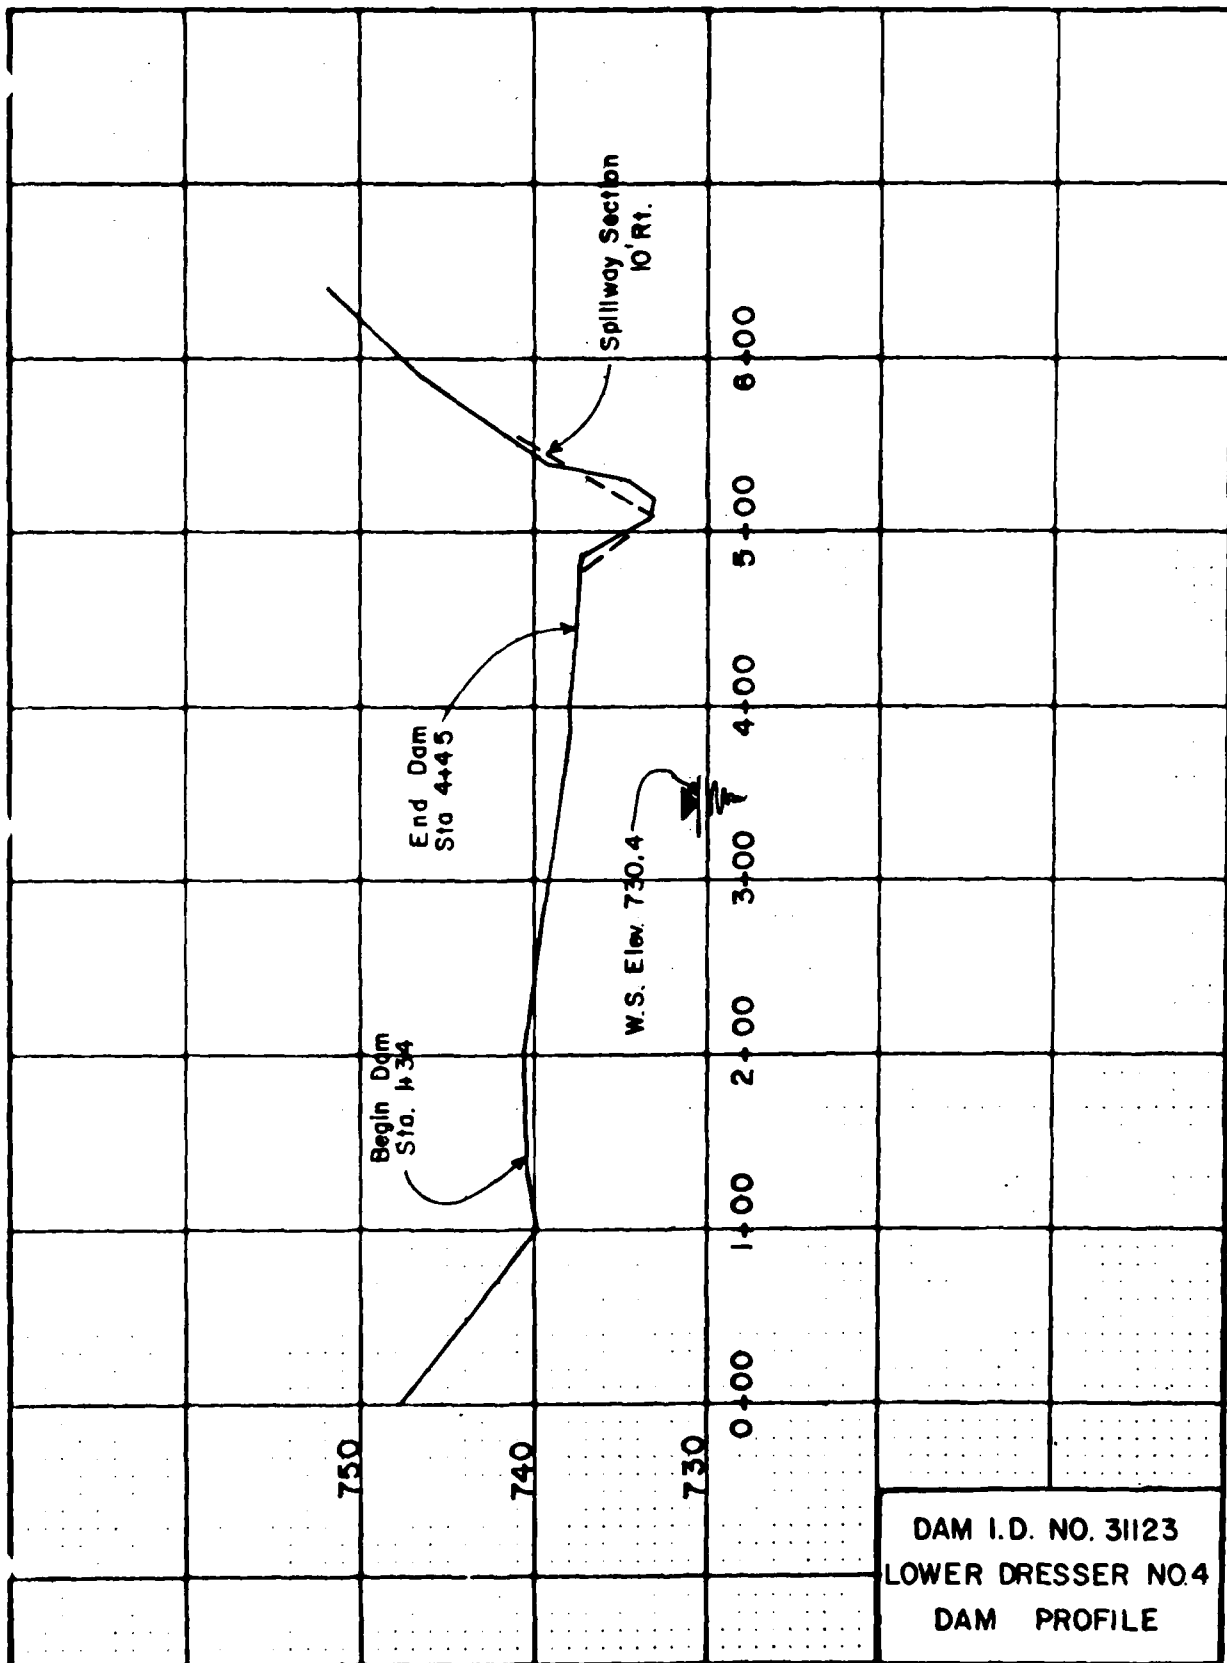

DAM I.D. NO. 31123
 LOWER DRESSER NO. 4
 DAM PROFILE


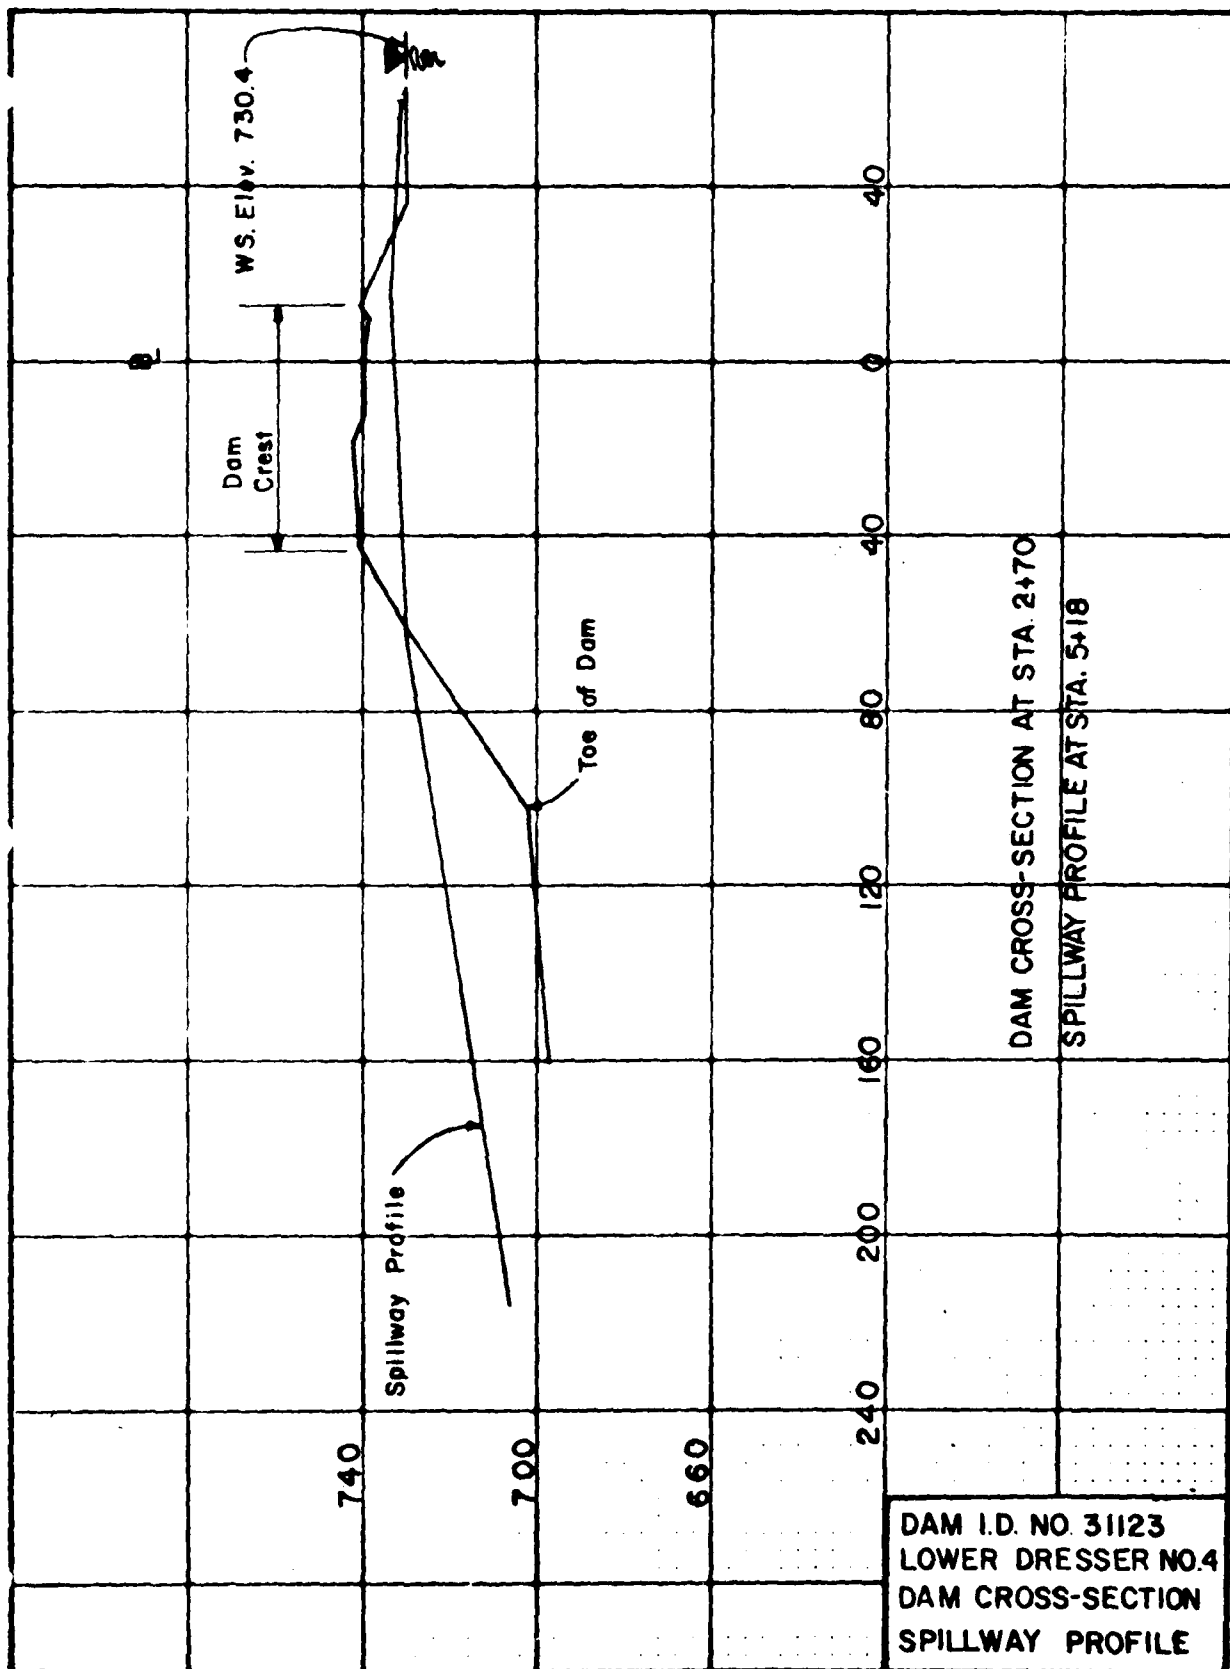


PLATE 5

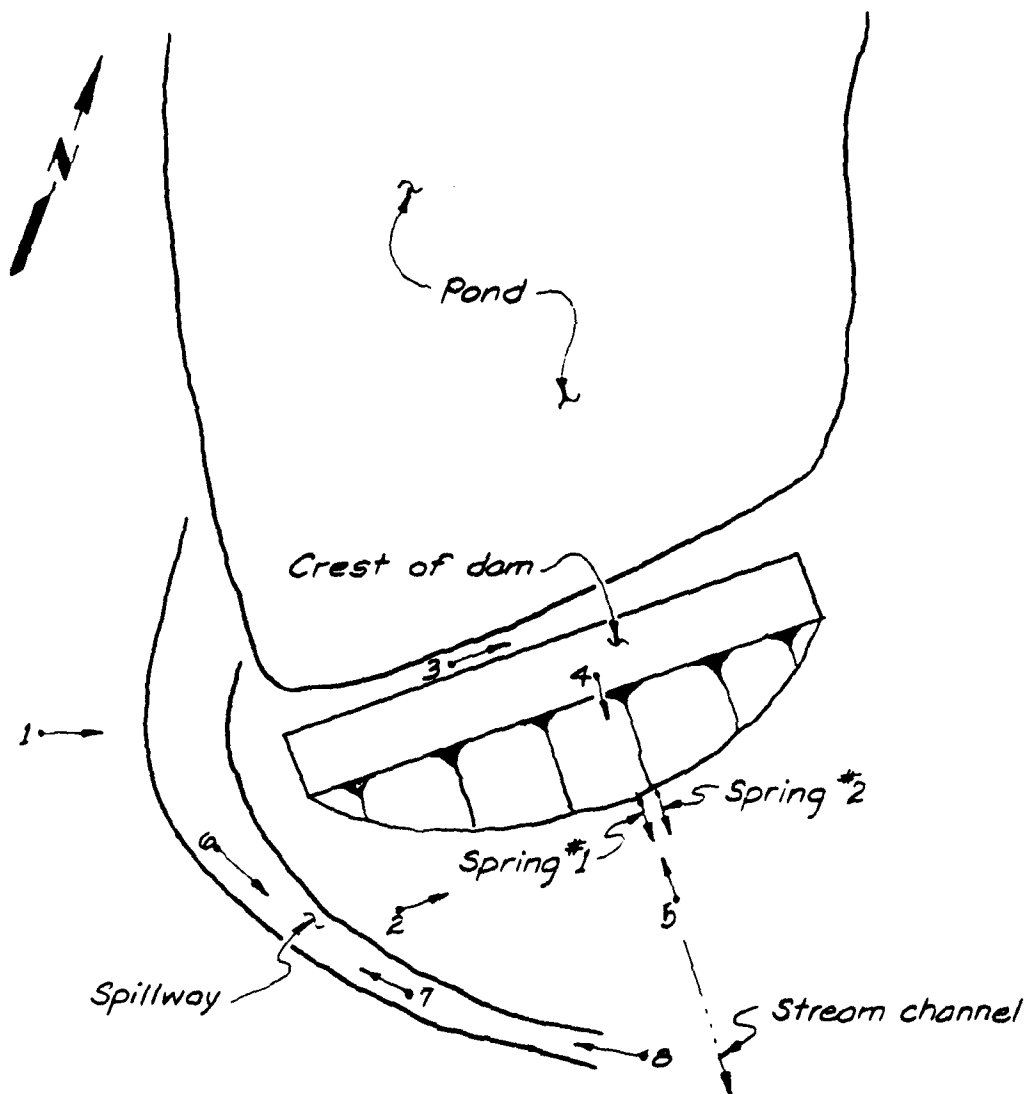

Not to scale

LEGEND:

4 → Photo number and view direction.

U.S. CORPS OF ENGINEERS, ST. LOUIS DIST.

PHASE I INSPECTION OF DAMS
LOWER DRESSER NO. 4 DAM I.D. 31123
PHOTOGRAPH LOCATION MAP

CONSULTING ENGINEERS
INTERNATIONAL ENGINEERING COMPANY, INC.
220 MONTGOMERY STREET, SAN FRANCISCO, CALIFORNIA 94104

DESIGNED BY: _____
CHECKED BY: *RV* _____
APPROVED BY: _____

DATE: _____
DRAWING NO.: **PLATE 6**

PHOTOGRAPH RECORD

LOWER DRESSER NO. 4 DAM - I.D. NO. 31123

<u>Photo No.</u>	<u>Description</u>
1.	View of dam and pond from right abutment. The spillway channel is in foreground, between the survey laths and vehicles.
2.	Downstream face of dam from right abutment.
3.	Upstream face of dam towards left abutment. Scarp and beach were caused by wave erosion.
4.	Two springs at toe of dam. Spring No. 1 is at the right side of photograph and Spring No. 2 is on the left side.
5.	Spring No. 1 at toe of dam.
6.	View downstream in spillway. The channel narrows in the downstream direction.
7.	View upstream in spillway channel showing condition of bedrock.
8.	Downstream end of spillway channel.









7



8

